



Wallwork™
TRUCK CENTER

www.wallworktrucks.com

Wallwork Truck Center

14058 James Drive
Williston, ND 58801

(701) 774-3007

Invoice: **0409S402477**
Date / Hour: 8/10/2021 2:30:16PM
Repair Order: 402477
Customer: 06410
Branch: Williston
Total Invoice: \$10,060.99
Charge

Page 1 of 12

Bill To: Ruach Resources
1027 S Welo St
1027 S WELO ST
TIOGA, ND 58852

Ship To: Ruach Resources
Triple Aggregate LLC
1027 S WELO ST
TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 cherz rzinke Orig R/O: 0 Completion Date: 08/10/2021

Unit Number: 265

Model Year: 2007

Make/Model: Kenworth T800

Type: Kenworth

VIN: 1XKDDU9X37J162940

Meter: 633075 Miles

ECM Reading: 26138

Delivery Date : 2006-08-05

Task: 1 13-10000 Brakes - Air Brakes - Diagnose Department: Service

90018

Complaint: Perform Kw Fri 09kw7 Brake Assembly Cracking

Cause: Kw Fri 09kw7

Correction: Verified Recall has not been done.

Front drive right side spider is broken
Supported rear axles on jack stands.
Removed all tires, drums, brake shoes, brake cans, slack adjusters, s-cams, and s- cam tubes.
Slack adjusters were seized on took a lot to get them off.
Hardware for tube assemblies were seized on.
Cleaned parts for reuse and inspected.
Due to the slack adjusters not being lubricated and seized they will need to be replaced. Also the s-cams were worn excessively as well.
With the new updated tube assemblies I could not get them to fit the spiders that were currently on the truck. Checked with parts and these were the correct tube assemblies per Vin of the truck from Bendix
Discovered that all of the spiders need to be changed out to the new style.
Got all the extra parts needed for repairs.
Disassembled all wheel ends and removed all spiders.
Cleaned up all sealing surfaces and all parts for reuse. Inspected and replaced what needed to be replaced.
Couple of spindle ends where seal rides had some deep gouges. Got them cleaned up and filled in.
Right front drive axle had a couple studs that were stretched
Replaced with new hardware
Installed all new updated spiders and tube assemblies.
Installed all wheel ends and set ABS sensors.
Installed new s-cams and new slack adjusters.
Installed brake cans, with one new clevis on the front drive right side, brake shoes, and drums.
Installed tube assembly straps front axle needed 2 new ones as the others were broke off and gone.
Replaced seals and hardware where needed.
Filled all wheel ends with fluid and installed all wheels.
Started truck and let build up system air pressure.
Greased slack adjusters and s-cams.
Adjusted all brakes steer axle and both drive axles.
Checked over and tied everything up.
Took truck for a test drive and everything was good . Brakes worked really good and was not pulling when braking.

Vin# 162940
Esn# KCB69828
Hrs: 26138

F--013-002-065
D--115-21

** See Last Page for Invoice Total **



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 2 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 cherz rzinke Orig R/O: 0 Completion Date: 8/10/2021

SRT: 013-901 Inspect Brake Components for Cracks	Hours: 0.50
SRT: 013-902 Replace cracked cam tube and install cam tube supj	Hours: 5.20
SRT: 013-001 Replace All 4 Brake Spiders	Hours: 6.40

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	03-01568	GASKET-AXLE SHAFT	Each	4.0	\$3.73	\$14.92
	08-02564	STRAP-BRACKET REINFORCEMENT	Each	2.0	\$17.88	\$35.76
ship ups to williston store asap please and thank you						
	47691CHR	SEAL	Each	4.0	\$35.41	\$141.64
	K122312NBXW	BRACKET-CAMSHAFT	Each	2.0	\$215.02	\$430.04
	K122313NBXW	BRACKET ASM 13500X056	Each	2.0	\$215.02	\$430.04
	K125329NBXW	PIN ASSY-SPIDER	Each	4.0	\$350.59	\$1,402.36
Task 1 Subtotals					Parts:	\$0.00
					Labor:	\$0.00
Task 1 Subtotals						\$0.00

Task: 2 13-00000 Brake System - Diagnose Department: Service
Complaint: Brake parts not covered under warranty
Correction: Slack adjusters were completely seized due to lack of grease causing damage to the S-cams
 Right front axle shaft had a couple studs that were stretched and could not be torqued
 Replaced all componets with new parts
 Freight for cam tube straps not covered by warranty

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	1229W1661	WASHER	Ea	3.0	\$0.88	\$2.64
	40010155M1D	ADJUSTER-BRAKE KW, 10 SPL, 5	Each	4.0	\$114.83	\$459.32
BRACKET PART # 42710585						
	808068	CAMSHAFT-(CCW)	Each	2.0	\$81.89	\$163.78
	808069	CAMSHAFT	Each	2.0	\$81.89	\$163.78
	CM103430	STUD-DOUBLE ENDED	Each	3.0	\$3.70	\$11.10
	HWU05665	NUT, NF NYLON LOCKNUT- 5/8-1	Each	3.0	\$2.32	\$6.96
	Interbranc	Interbranch Freight		1.0	\$14.17	\$14.17
Task 2 Subtotals					Parts:	\$807.58
					Labor:	\$0.00
					Miscellaneous:	\$14.17
Task 2 Subtotals						\$821.75

Task: 3 13-99990 Abs Diagnosis And Repair Department: Service
Complaint: Check/Repair Abs & T/C light



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 3 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 cherz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Correction: Hooked up to truck and pulled codes.
 Code for steering angle sensor and right rear drive axle wheel speed sensor.
 Checked wheel speed sensors while doing brake repairs & found both right side sensors need to be replaced
 After repairing the wheel speed sensors and test driving truck the abs light went away but the traction control light was still on.
 Hooked up to truck and pulled codes there was no longer any active faults for the abs or traction control. Looked over wiring and with this truck
 having an automatic and all the wiring cut under cab and looped together or just left cut might have an issue with the data link.
 Truck was converted from an automatic to a standard transmission.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	801538W	WHEEL SPEED SENSOR	Each	1.0	\$50.16	\$50.16
	801538W	WHEEL SPEED SENSOR	Each	1.0	\$50.16	\$50.16
				Task 3 Subtotals	Parts:	\$100.32
					Labor:	\$334.00
				Task 3 Subtotals		\$434.32

Task: 4 45-000000 Engine System Department: Service

Complaint: Check/Advise running rough
Correction: Hooked up to truck and checked codes.
 The only thing recently active was for the boost pressure sensor.
 Checked boost pressure sensor and sensor with amp seal connector will need to be replaced.
 Warmed truck up to operating temperature. Ran cylinder cut out. All ok.
 Checked engine over.
 Found various minor oil leaks.
 Will need to check the fuel system pressure and for air in the system.
 Every time truck has been started, running, and test driver truck has ran great. Found no issues with the fuel system at this time and cleaned up
 boost pressure sensor connector and got it to lock no more codes.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
				Task 4 Subtotals	Parts:	\$0.00
					Labor:	\$501.00
				Task 4 Subtotals		\$501.00

Task: 5 32-010010 Starting System - Batteries And Cables - Diagnose Department: Service

Complaint: Check/Repair Batteries die over night



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 4 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 chertz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Correction: Started truck to bring into shop after sitting.
 Truck started right up.
 Noticed the radio was flickering on/off when everything was off and key off.
 Battery cable ends in battery box need cleaned up.
 Recommend installing a master switch.
 Checked over all wiring to battery box.
 Removed radio and disconnected a few other things to locate draw on system.
 There's so much tapped into wiring or cut up wiring everywhere it was hard to find what was being used and what wasn't. Hooked everything back up and assembled dash.
 Disconnected batteries cleaned up all cable ends and battery terminals.
 Installed master switch on right hand side of battery box.
 Hooked up everything in battery box with new jumper/ battery connectors.
 Tied up wiring and installed battery box cover.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	BA22100	SWITCH-BATTERY DISCONNECT	Each	1.0	\$51.66	\$51.66
	BC1044	BATT CABLE/DA094	Each	3.0	\$34.22	\$102.66
	BC1052	BATT CABLE/DA094	Each	2.0	\$34.22	\$68.44
				Task 5 Subtotals	Parts:	\$222.76
					Labor:	\$501.00
				Task 5 Subtotals		\$723.76

Task: 6 901050 Courtesy Vehicle Inspection Williston
Complaint: Perform Courtesy Inspection

Department: Service



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 5 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 chertz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Correction: Performed Courtesy Inspection
 Faults found
 Exhaust leak under cab
 Wiper blades need to be replaced
 Driverside Hood maker/turn signal light inop
 Exterior courtesy light inop
 DS high beam headlight is brokem
 Cargo lights inop
 Outside air temp inop
 No rear mudflaps or hangers
 Front diff output yoke is loose and leaking
 Driver side rear drive ABS sensor
 Left side rear axle s-cam looks off
 Rear drive axle S-cam tubes missing supports
 Front drive Right side spider broken
 Front drive axle s-cam tubes missing supports
 Clutch needs adjustment
 Large transmission leak on top of trans
 cab shock blown out
 Missing air filter intake pipe
 Steering angle sensor
 Exhaust leak between turbos
 Dip stick provision plug leaking oil
 Low pressure turbo mounting
 Steering wheel needs to be clocked
 Front drive axle shocks
 Driver side rear engine mount bolt backed out
 Valve cover base harness connector leaking oil
 Driver side king pin retaining pins not seated properly
 Boost pressure sensor and amp seal connector
 Power steering leak at fitting on pump
 Radiator ground not hooked up
 Davco water seperator leaking fuel
 Cooling system needs to be flushed and replaced with new coolant
 low air flow out of vents for HVAC system
 A/C compressor does not cycle and evaporator and expansion valve freeze up
 Radio might be drawing power when truck is sitting

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	PromoLabSv	Promotional Labor Credit - Service		-1.0	\$33.40	(\$33.40)
				Task 6 Subtotals		
				Parts:		\$0.00
				Labor:		\$33.40
				Miscellaneous:		(\$33.40)
				Task 6 Subtotals		\$0.00

Task: 7 42-00000 Cooling System
 Complaint: Recommend Flushing Cooling System

Department: Service

** See Last Page for Invoice Total **



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 6 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 chertz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Correction: Drained cooling system.
 Added cooling system cleaner and filled with water to flush system.
 Got system up to operating temperature and let run for 90 min at operating temperature with the heat on.
 Drained system.
 Filled with water and let heat cycle for 30 min.
 Drained system and filled with coolant.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	CC2610FLG	RESTORE CLEANER	Each	1.0	\$22.45	\$22.45
				Task 7 Subtotals	Parts:	\$22.45
					Labor:	\$501.00
				Task 7 Subtotals		\$523.45

Task: 8 23-010001 Clutch - Clutch Control - Adjust Department: Service

Complaint: Adjust clutch
Correction: Made internal and external adjustment.
 External adjustments were a little more difficult with home made link rods
 Verified clutch adjustment was in-spec.
 Clutch is adjusted

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
				Task 8 Subtotals	Parts:	\$0.00
					Labor:	\$167.00
				Task 8 Subtotals		\$167.00

Task: 9 34-000000 Lighting System Department: Service

Complaint: Check/Repair - DS high beam headlight broken
 Driverside Hood maker/turn signal light inop
Correction: Drivers side high beam head light cracked
 Removed light and installed new light.
 Cargo lights not working.
 Checked sockets and no power to them
 Switch operating properly.
 Found fuse was missing and installed new fuse.
 Cargo lights working. Installed covers.
 Door entry lights inop.
 Found both bulbs burnt out.
 Replaced bulbs and could get lights to work but sockets are really corroded and need replaced. Could not just get pigtail sockets. Cleaned up socket connections and reinstalled. Lights working properly.
 Left side hood marker/turnsignal light inop.
 Removed light and wiring harness.
 Had to cut mounting hardware off of hood due to being corroded.
 Installed new light and wiring assembly.
 Repaired all damaged wiring found in that corner.
 Checked all lighting operations.
 All exterior lights work properly.



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 7 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 chertz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	1-1962	14/16-S	Each	10.0	\$0.39	\$3.90
	CC11150	BREAKER-CIRCUIT 15AMP	Each	1.0	\$8.00	\$8.00
	G5543	LAMP-HI COUNT LED 2 SIDED W/	Ea	1.0	\$87.67	\$87.67
	H4651	SEALED BEAM	Each	1.0	\$6.72	\$6.72
	LB904	BULB-12V 4CP WEDGE BASE	Each	2.0	\$0.39	\$0.78
				Task 9 Subtotals	Parts:	\$107.07
					Labor:	\$501.00
				Task 9 Subtotals		\$608.07

Task: 10 02-350294 Cab - Windshield Wiper Blades - Replace **Department: Service**
 Complaint: Replace Wiper blades
 Correction: Removed wiper blades.
 Installed new wiper blades.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	122042EXX	DELVAC 75W-90 SYN	Each	6.0	\$4.15	\$24.90
	31-18	BLADE-WIPER	Each	2.0	\$3.12	\$6.24
	63-181	18 TRICO HD HEAVY DUTY WIP	Each	2.0	\$8.88	\$17.76
				Task 10 Subtotals	Parts:	\$48.90
					Labor:	\$33.40
				Task 10 Subtotals		\$82.30

Task: 11 14-040003 Frame - Cab And Body Mounts - Repair **Department: Service**
 Complaint: Check/Repair - Cab shock needs to be replaced
 Correction: Removed cab shock and replaced with new shock.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	R71-1004	ABSORBER-SHOCK	Each	1.0	\$59.99	\$59.99
				Task 11 Subtotals	Parts:	\$59.99
					Labor:	\$133.60
				Task 11 Subtotals		\$193.59

Task: 12 16-000000 Suspension **Department: Service**
 Complaint: Check/Repair - Front drive axle shocks need to be replaced
 Correction: While wheel ends were removed replaced front drive axle shocks.
 The bolts were seized on.
 Had to heat up with torch and replace some of the hardware.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	65524MOR	SHOCK ABSORBER	Each	2.0	\$56.69	\$113.38
	HWC04718	CAPSCREW-METRIC	Each	1.0	\$8.69	\$8.69

** See Last Page for Invoice Total **



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 8 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265	cherz	rzinke	Orig R/O: 0	Completion Date: 8/10/2021
HWC12501	NUT HEX M 16 X 2 10.0	Each	1.0	\$1.48 \$1.48
Task 12 Subtotals			Parts:	\$123.55
			Labor:	\$167.00
			Task 12 Subtotals	\$290.55

Task: 13 03-000000 Instruments And Gauges

Department: Service

Complaint: Check/Repair - Speedometer inop

Correction: Speedometer not working.

Looked under truck for speed sensor.
 Found a pile of wiring tied up around transmission.
 Found the twisted pair of wiring for a speed sensor not hooked up.
 Checked the output of transmission and there was no speed sensor.
 Checked speed sensor mounting location and found part of a broken sensor stuck inside.
 Ground out broken sensor and cleaned up mounting hole.
 Installed new speed sensor and hooked up wiring.
 Hooked up to truck and took for a test drive.
 Dash and computer was not registering speed still.
 Checked wiring from sensor plug to harness connector under truck.
 Harness connector under truck is all hacked up and speed sensor wiring was spliced in.
 Looked up schematic for OEM ECM connector.
 Removed connector from ECM and ohmed wiring from ECM connector to speed sensor connector and it was open. Looked up wiring schematics for the truck side to chase wiring.
 Started checking wiring and everything from the speed sensor connector to fire wall connector was good.
 While looking through schematics to figure out the wiring from the ECM to firewall noticed this truck originally had an automatic transmission in it and the wiring was all ran through data link.
 Will not be able to use the wiring that they have it hooked up too.
 Had to make a new twisted pair harness and ran from ecm connector to speed sensor.
 Hooked up ecm connector and tied up new speed sensor wiring harness.
 Took truck for a test drive and speedometer was working again.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	1-1961	22/18GA-SHRINK	Each	2.0	\$0.39	\$0.78
	5-023	WIRE LOOM	FT	10.0	\$0.15	\$1.50
	K4148	SPEEDO SENSOR ASSY	Each	1.0	\$41.76	\$41.76
Task 13 Subtotals				Parts:		\$44.04
				Labor:		\$751.50
				Task 13 Subtotals		\$795.54

Task: 14 41-000000 Intake System

Department: Service

Complaint: Check/Replace - Intake pipe from air inlet on hood to air filter is missing

Correction: Removed broken pieces.

Installed new intake pipe.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	D66-1548	DUCT-ENGINE AIR INTAKE HIGH	Each	1.0	\$183.73	\$183.73

** See Last Page for Invoice Total **



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 9 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 cherz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Task 14 Subtotals Parts: \$183.73
 Labor: \$50.10
 Task 14 Subtotals \$233.83

Task: 15 01-010000 Hvac System - General Diagnostic And Repair Department: Service

Complaint: Check/Repair - A/C inop
Correction: Low flow out of vents.
 A/C freezing over and fan staying on.
 Checked over A/C system and looks like most has been replaced.
 Hooked up a/c machine and recovered.
 System was low on freon.
 Pulled into vacuum and leak checked.
 Everything passed.
 Charged system to proper spec 3.25 lbs and added 1 oz oil.
 Started truck and checked over.
 Shut down and removed intake piping.
 Removed HVAC box cover.
 Found freeze switch not installed.
 Installed freeze switch.
 Made sure blower motor was hooked up correctly and squirrel cages were on correctly.
 Seen that fresh/ recirc actuator was not hooked up or working.
 Shut frsh air door to recirc and installed HVAC box cover.
 Installed missing mounting bolts for expansion valve and tied up a/c lines better.
 Ran everything on a/c system and operated as it should fan was cycling correctly.
 No more freezing up. A/C blowing cold out of vents.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	600051	SCREW	Each	2.0	\$0.51	\$1.02
	Freon	Freon		2.0	\$25.00	\$50.00
				Task 15 Subtotals	Parts:	\$1.02
					Labor:	\$584.50
					Miscellaneous:	\$50.00
				Task 15 Subtotals		\$635.52

Task: 17 43-000008 Exhaust Piping/Flex Repair Department: Service

Complaint: Check/Repair - Exhaust leak between turbos and under cab



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 10 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 chertz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Correction: Exhaust leak at pipe connecting turbos.
 Removed pipe and cleaned sealing surfaces.
 Everything looked good will just need to seat pipe properly and install new clamp.
 Installed piping with new clamp.
 Installed missing hardware on high pressure turbo mounting to manifold and low pressure turbo mounting to pedestal.
 The mounting hardware for both turbos is incorrect and if it keeps loosing hardware will need to be fixed correctly
 Large exhaust leak under cab.
 Removed passenger side lower door valence.
 Removed exhaust flex pipe from turbo to connection under cab.
 Found that flex pipe was too long and clamps were not properly being used & the solid pipe in the rear of truck is damaged and will also need to be replaced to seal correctly.
 Removed all exhaust piping and muffler assembly.
 Removed damaged piece of piping.
 Installed new piece of piping.
 Installed muffler assembly with the back half of exhaust piping.
 Lined up exhaust piping and installed all new clamps.
 Installed support clamp with new hardware had to cut other hardware off was to corroded.
 Cut down flex pipe that was on truck and routed.
 Installed with new clamps.
 Started truck and checked over for leaks.
 Installed side skirting.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	2396807	CLAMP AS-V-B	PC	1.0	\$19.96	\$19.96
	50AS	CLAMP	Each	1.0	\$9.47	\$9.47
	EC50PLA	CLAMP-EXHAUST WB PREFRMD 5	Each	3.0	\$6.14	\$18.42
	LOYALTY CARD: Y212000 YR DISC: 1					
	M66-1420	PIPE-EXHAUST 45DEG 5 STL AL	Each	1.0	\$328.29	\$328.29
Task 17 Subtotals					Parts:	\$376.14
					Labor:	\$668.00
					Task 17 Subtotals	\$1,044.14

Task: 18 22-000000 Rear Axle

Department: Service

Complaint: Check/Repair - Front diff output yoke is loose and leaking
 Customer states their shop recently put a new thru shaft in the diff along with a cage (?)
Correction: Out put yoke nut front differential loose and leaking puddles of fluid on ground .
 Removed intermediate drive shaft.
 Removed yoke.
 Removed seals, cleaned sealing surfaces, and cleaned parts for reuse.
 Installed new seals.
 Installed yoke with new nut and loctite.
 Installed intermediate drive shaft.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	40X1237	PINION NUT	Ea	1.0	\$10.83	\$10.83

** See Last Page for Invoice Total **



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 11 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O:	265	cherz	rzinke	Orig R/O:	0	Completion Date:	8/10/2021
A11205Y2729	MULTI-LIP SEAL	Ea	1.0	\$55.28	\$55.28		
Task 18 Subtotals				Parts:		\$66.11	
				Labor:		\$350.70	
				Task 18 Subtotals		\$416.81	

Task: 19 26-000000 Transmission - Manual Department: Service

Complaint: Check/Advise - Verify what is leaking on transmission. If trans has to be pulled to fix leak customer does not want to repair at this time
Correction: Checked over transmission for leaks. Entire transmission covered in fluid. Looks like the major leak is coming from the shift tower gasket. A cover in the rear of the transmission is leaking from bolts being loose or not installed. During inspection also noticed that the transmission is missing some mounting bots and bolts are coming loose as there is space between the top of the transmission and the flywheel housing.

Removed all transmission bolts 1 by 1 and replaced all washers then loctite and torqued each bolt. Transmission shift tower was missing gasket and detent springs. Rear cover with loose bolts that was leaking. Removed cover and installed new seal. Tightened up cover and it was cracked. Got shim kit and checked clearnces and was off. Reshimed and installed new cover and set torqued to spec. Took truck for a test drive. Everything wroks as it should now & no leaks

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	15918	SPRING	Each	3.0	\$0.82	\$2.46
	4302320	COVER	Each	1.0	\$37.61	\$37.61
	4307247	GASKET AUX BRG COVER	Each	2.0	\$5.01	\$10.02
	4308850	GASKET-COVER,BRG,REAR	Each	1.0	\$5.50	\$5.50
	K2805	KIT GASKET	Each	1.0	\$40.39	\$40.39
Task 19 Subtotals				Parts:		\$95.98
				Labor:		\$1,670.00
				Task 19 Subtotals		\$1,765.98

Task: 20 15-000000 Steering Assembly Department: Service

Complaint: Check/Repair - Driver side king pin retaining pins not seated properly
Correction: Drivers side king pin retaining pins not seated correctly.
 Jacked truck up and removed tire.
 Removed both pins and cleaned them up.
 Cleaned out holes.
 Installed pins fully seated and torqued nuts.
 Greased king pin and top knuckle cap pushed off.
 Cleaned up and inspected knuckle threads were damaged and cap threads were damaged.
 Cleaned up knuckle threads.
 Installed new cap and got it to thread all the way down.
 Installed grease zerk and greased king pin.
 Installed tire torqued to spec.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
	971370ETN	KNUCKLE CAP	Each	1.0	\$15.05	\$15.05
Task 20 Subtotals				Parts:		\$15.05
				Labor:		\$668.00

** See Last Page for Invoice Total **



Wallwork Truck Center
 14058 James Drive
 Williston, ND 58801
 (701) 774-3007

Invoice: **0409S402477**
 Date / Hour: 8/10/2021 2:30:16PM
 Repair Order: 402477
 Customer: 06410
 Branch: Williston
 Total Invoice: \$10,060.99
 Charge
 Page 12 of 12

Bill To: Ruach Resources
 1027 S Welo St
 1027 S WELO ST
 TIOGA, ND 58852

Ship To: Ruach Resources
 Triple Aggregate LLC
 1027 S WELO ST
 TIOGA, ND 58852

Work: (701) 664-3500

Shop: 701-421-1977

Customer P/O: 265 chertz rzinke Orig R/O: 0 Completion Date: 8/10/2021

Task 20 Subtotals \$683.05

Task: 21 10-900000 Chassis Lube **Department: Service**

21504

Complaint: Grease chassis

Correction: Greased chassis.

Had to install grease zerks on transmission cross shafts and front clutch linkage arm.

Supp.	Part	Description / Ref Number	U/M	Quantity	Price	Extended Price
				Task 21 Subtotals	Parts:	\$0.00
					Labor:	\$0.00
				Task 21 Subtotals		\$0.00

Detail Tax Info:

ND Sales Tax	\$116.94
Williams County Exempt	\$0.00
Williams County Taxable	\$23.39
Total:	\$140.33

Total Parts:	\$2,274.69
Total Labor:	\$7,615.20
Total Miscellaneous:	\$30.77
Invoice Subtotal:	\$9,920.66
Total Tax:	\$140.33
Total Invoice:	\$10,060.99

<u>Payment Method</u>	<u>Terms</u>	<u>Due Date</u>
Charge	Net 10th	9/10/2021

Remit To:
 Wallwork Truck Center Williston
 P.O. Box 1819
 Fargo, ND 58107-1819

The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items. Clerical errors subject to correction. 1.5% per month service charge on all past due accounts.