

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
8/26/2021	937

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over and repair

Serial Number	Terms	Hours	Model
673116	Due on receipt	3276E/2259S	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service call	30.00	30.00
1	Combine check over	Check over	300.00	300.00
1	AH112883	Seal	20.93	20.93
1	U10063	O-ring	5.07	5.07
1	H110521	Cap	11.60	11.60
1	AH168783	Filter	59.93	59.93
1	A-AH149356	Fan sheave upper inner	338.29	338.29
1	A-AH229175	Thrust bearing	32.77	32.77
1	A-AXE18077	Front grain tank auger	553.69	553.69
1	A-AXE18078	Rear grain tank auger	555.28	555.28
4	A-JD39104	Bearing	28.10	112.40
1	A-AF55747	Recirculating filter	80.66	80.66
6	75w-90SGL	Synthetic gear lube	17.28	103.68
4	A-FF149J	Fuel filter	7.38	29.52
10.75	Labor	Labor	85.00	913.75
	Check over discount	Check over discount (parts and labor over \$1000.00)	-300.00	-300.00
1	Shipping	Shipping on Parts	41.92	41.92
1	Shop Supplies	Shop supplies used for repair	14.08	14.08
1	MN sales tax	0.06875%	0.96	0.96

Total
Payments/Credits

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
8/26/2021	937

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over and repair

Serial Number	Terms	Hours	Model
673110	Due on receipt	32761/2259S	9500

Quantity	Item	Description	Price Each	Amount
		Checked over combine for needed repairs and discussed with customer. Changed reverser oil. Adjusted intermediate cylinder drive pulley sheave gap. Changed dual range oil. Removed cob from walker plugged sensor. Changed primary counter shaft gear case oil. Replaced upper inner cleaning fan sheave and thrust bearing. Serviced batteries. Tightened A/C compressor belt. Blew out engine air filter. Replaced both cab filters. Straightened grain tank sample trough. Replaced both unload cross augers. Made all necessary adjustments. Greased combine. Run and checked operation.		
-1	R26906	Returns form Invoice #885	2.81	-2.81
-1	AR26724	O-Ring	21.75	-21.75
-1	Shipping	Elbow fitting Shipping on Parts	6.00	-6.00
Total				\$2,873.97
			Payments/Credits	-\$2,873.97

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
10/16/2020	786

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Replace header drive belt

Serial Number	Terms	Hours	Model
673110	Due on receipt	3254E/2243S	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call	30.00	30.00
1	H151952	Header drive belt	141.49	141.49
1.5	Labor	Labor Replaced header drive belt	80.00	120.00
			Total	\$291.49
			Payments/Credits	-\$291.49

Anderson Repair

22302 Kandi-Mecker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/1/2020	727

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over

Serial Number	Terms	Hours	Model
673110	Due on receipt	3195E/2208S	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call	30.00	30.00
1	Combine check over	Check over	280.00	280.00
1	U12547	O-ring	2.20	2.20
1	AR95758	Outer engine air filter	81.09	81.09
1	MIU14478	Regulator	63.01	63.01
2	75w-90SGL	Synthetic gear lube	17.28	34.56
3	AH128449	Hyd. filter	53.60	160.80
1	4561	9000 series combine front headliner	183.00	183.00
1	QPH145158	Rotary screen belt	54.90	54.90
		Checked over combine and gave customer a list of needed repairs. Customer did the repairs himself.		

Total			\$889.56
Payments/Credits			-\$889.56

Anderson Repair
 22302 Kandi-Meeker Rd
 Atwater, MN 56209

Parts Invoice

Phone # 320-220-2164

Date	Invoice #
8/14/2019	586

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Terms
Due on receipt

Quantity	Item	Description	Price Each	Amount
1	1202	JD 9000 series combine mud scraper	1,106.00	1,106.00
Total				\$1,106.00

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/22/2019	579

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over Replace hydro pump input seal

Serial Number	Terms	Hours	Model
673110	Due on receipt	3119E / 2161S	9500

Quantity	Item	Description	Price Each	Amount
1	Combine check over	Check over	280.00	280.00
1	AN193085	Seal	333.79	333.79
1	19M7866	Flange Bolt	0.95	0.95
2	14M7298	8MM Flange nut	0.74	1.48
1	AR73234	Wing nut	5.05	5.05
4	TY26576	CoolGard II	13.86	55.44
1	A-H202647	Cutter bar drive belt	63.86	63.86
6	75w-90SGL	Synthetic gear lube	17.28	103.68
1	S-74	#194 bulb socket pig tail	5.06	5.06
2	STP131HC	14-16g Heat Shrink Butt Connector	2.04	4.08
1	#194	Bulb	1.15	1.15
1	R72328	O-ring	1.28	1.28
3	A-HS20003	Hose	0.73	2.19
1	R63308	O-ring	6.80	6.80
1	R68230	Water pump	241.67	241.67
1	R96616	Gasket	2.42	2.42
2	H135155	Clamp	7.05	14.10
1	19H1901	Bolt 5/16 X 2	1.19	1.19
1	12H1303	5/16" Lock washer	0.22	0.22
1	14H1785	5/16" Nut	0.30	0.30
16.91	Labor	Labor	80.00	1,352.80
1	Shipping	Shipping on Parts	12.98	12.98
1	Shop Supplies	Shop supplies used for repair	10.98	10.98
1	MN sales tax	0.06875%	0.75	0.75
	Check over discount	Check over discount (parts and labor over \$1000.00)	-280.00	-280.00
Total				
Payments/Credits				

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/22/2019	579

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over Replace hydro pump input seal

Serial Number	Terms	Hours	Model
673110	Due on receipt	3119E / 2161S	9500

Quantity	Item	Description	Price Each	Amount
		Checked over combine for needed repairs and discussed with customer. Drained hydraulic oil and removed hydro pump. Replaced hydro pump input seal and reinstalled hydro. Cleaned out head latch pins so that they would function properly. Replaced missing bolt for shoe auger drive pulley. Changed reverser, primary counter shaft gear case oil, and dual range oil. Welded crack in side sheet just above and rear of threshing cylinder. Removed cob from walker plugged sensor. Replaced missing nut for contour master hyd. line on left side of machine. Installed plastic piece under cab windshield properly. Replaced missing clamp for steering hoses by dual range gear case. Blew out radiator. Replaced broken outer engine air filter wing nut. Blew out outer engine air filter. Replaced leaking water pump. Changed coolant. Blew out cab fresh air filter. Replaced left rear tail marker bulb socket. Replaced burnt out bulb for right rear tail marker light. Freed up cleaning fan speed adjust mechanism. Lubed all chains. Greased combine and made necessary adjustments. Run and checked operation.		
			Total	\$2,222.22
			Payments/Credits	-\$2,222.22

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
10/21/2018	493

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Hyd. pump leak warranty

Serial Number	Terms	Hours	Model
673110	Due on receipt		9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call	30.00	30.00
1	AH227021	Hyd. pump front section	851.03	851.03
3	Labor	Labor	80.00	240.00
	Warranty	Warranty Discount Replaced leaking hyd pump with a new one.	-1.121.03	-1.121.03
			Total	\$0.00
			Payments/Credits	\$0.00

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
9/29/2018	481

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Oil leak by dual range cylinder.

Serial Number	Terms	Hours	Model
673110	Due on receipt		9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call	30.00	30.00
70	A-P100R16-8	1/2" - 2 Wire hydraulic hose (sold by the inch)	0.46	32.20
2	A-FFX-08-08-W	Female flat face swivel hydraulic hose fitting	10.77	21.54
2.33	Labor	Labor	80.00	186.40
1	Shop Supplies	Shop supplies used for repair	3.60	3.60
1	Sales Tax	Sales Tax 0.06875%	0.25	0.25
12.6	Milage	Return trip mileage	1.00	12.60
		Put out fire inside of intermediate cylinder drive pulley. Replaced steering hose from top right of steering metering pump to steel line by dual range that had rubbed through after clamp had come off and it rubbed on dual range cylinder drive pulley. Tied up steering and grease hoses so they would not rub. Replaced burnt cylinder drive belt. Run and checked operation.		

Total			\$286.59
Payments/Credits			-\$286.59

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/3/2018	447

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over

Serial Number	Terms	Hours	Model
673110	Due on receipt	3035E/2113S	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call		
1	Combine check over	Check over	30.00	30.00
29	A-11215004	Stationary Knife	280.00	280.00
1	AH115833	Cab fresh air filter	6.40	185.60
1	AH115836	Recirculating filter	57.87	57.87
1	AE41319	Sight glass	72.75	72.75
1	R29936	O-Ring	58.65	58.65
1	E65288	O-Ring	3.47	3.47
2	75w-90SGL	Synthetic gear lube	1.90	1.90
1	S-74	#194 bulb socket pig tail	17.28	34.56
1	#194	Bulb	5.06	5.06
2	STP131HC	14-16g Heat Shrink Butt Connector	1.15	1.15
1	Shop Supplies	Shop supplies used for repair	2.03	4.06
1	Sales Tax	Sales Tax 0.06875%	10.75	10.75
4.75	Labor	Labor	0.74	0.74
12	Milage	Return trip mileage	80.00	380.00
1	Shipping	Shipping on Parts	1.00	12.00
		Checked over combine for needed repairs and discussed with customer. Changed reverser oil. Serviced batteries. Replaced chopper knives. Replaced both cab filters and cleaned precleaner. Replaced right rear marker light bulb socket and bulb. Replaced leaking lower hydraulic reservoir sight glass. Blew out outer engine air filter. Removed steering pump from hyd. pump to check for any leakage between them and found no leakage that would transfer oil from one reservoir to another. Made all necessary adjustments. Greased combine. Run and checked operation. Lubed chains.	5.77	5.77
Total				\$1,144.33
Payments/Credits				-\$1,144.33

Anderson Repair

22302 Kandi-Meeker Rd
 Atwater, MN 56209
 Phone 320-220-2164

Date	Invoice #
10/12/2017	358

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Repair gost codes Codes coming up 03E, 04E, 36E, 122E

Serial Number	Terms	Hours	Model
673110	Due on receipt	2958E/2066S	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call	31.00	31.00
2	STP478	16-14g 5/16" eyelet	1.99	3.98
2	C14EB	14 gauge wire black	0.70	1.40
1	Labor	Labor	80.00	80.00
		Started with code 36E first. Checked resistance of injection pump rack position sensor and found it to be in specifications. Checked continuity of rack position sensor wires in engine harness and found them to be ok. 03E, 04E, & 122E are codes that have no reference otherwise known as ghost codes, did following repairs to try to solve them. When removing wire plug from ECU I found that bolt that holds plugs in ECU were loose, they were tightened upon reinstallation. Cleaned engine harness ground and added a ground wire to ECU to drain static electricity, all three items are possible reasons for ghost codes.		
Total				\$116.38
Payments/Credits				-\$116.38

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
9/28/2017	350

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Replace reel pump to reel valve hyd. hose Replace walker gear case seal and fill with corn head grease

Serial Number	Terms	Hours	Model
2948E/2062S	Due on receipt	673110	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call		
1	R26375	O-Ring	30.00	30.00
1	R39112	Plug	1.99	1.99
1	AH131876	Hydraulic hose	6.51	6.51
1	AH111970	Seal	65.86	65.86
3.76	Labor	Labor	33.46	33.46
		Replaced reel pump hose from pump to reel flow control valve. Drained walker gear case. Removed gear case hose and fitting. Replaced outside crank seal on walker gear case. Installed plug in walker gear case with a grease zerk. Filled walker gear case with corn head grease.	80.00	300.80
Total				\$438.62
Payments/Credits				-\$438.62

Anderson Repair

22302 Kandi-Meeker Rd
Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/3/2017	311

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over and repair

Serial Number	Terms	Hours	Model
673110	Due on receipt	2947E/2062S	9500

Quantity	Item	Description	Price Each	Amount
1	Service Call	Service Call		
1	Combine check over	Check over	30.00	30.00
1	A-AH159703	Feeder house bottom	280.00	280.00
1	A-AH141577	Lower clean grain auger	718.40	718.40
1	A-JD39102	Ball bearing	289.63	289.63
2	A-H103264	Flange	14.17	14.17
1	A-JD39103	Ball bearing	1.82	3.64
12	A-H1142188	Shoe auger wood block	12.83	12.83
8	A-AH1168158-SET	Walker wood block	8.31	99.72
1	82042	Poly Board	47.42	379.36
1	A-57502	Seal	30.27	30.27
1	A-AH151119	Front concave plate	17.01	17.01
5	A-AH171588	Straw chopper knife set	219.54	219.54
1	A-Ah208684	Ball joint	31.64	158.20
6	A-H103264	Flange	9.74	9.74
6	A-H36155	Shim	1.82	10.92
6	A-AH214862	Bearing w/lock collar	3.74	22.44
1	AN277320	Idler	18.63	111.78
1	AH112883	Seal	42.75	42.75
1	U10063	O-ring	17.22	17.22
1	H97306	Seal	4.36	4.36
1	AH139238	Union fitting	9.19	9.19
1	1411760	5/8 Nut	169.91	169.91
1	H1134773	Strap	1.22	1.22
1	AH1123016	Tail light lens	2.02	2.02
1	AH1150473	Walker plugged magnet	55.90	55.90
1	AH173464	Gearcase dipstick	20.49	20.49
2	AH108813	Ball bearing	93.36	93.36
1	AH120907	Hub assy.	81.43	162.86
			227.10	227.10
Total				
Payments/Credits				

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/3/2017	311

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over and repair

Serial Number	Terms	Hours	Model
673110	Due on receipt	2947E/2062S	9500

Quantity	Item	Description	Price Each	Amount
1	AH214333	Hardware kit	5.41	5.41
1	E65288	O-Ring	1.78	1.78
1	AH227021	Hyd. pump front section	769.39	769.39
1	AH227024	Hyd. pump rear section	742.10	742.10
2	51819	Hydraulic Filter	75.12	150.24
1	46774	Outer eng. air filter	103.19	103.19
1	46775	Inner air filter	80.20	80.20
1	QPH145158	Rotary screen belt	50.34	50.34
1	QPH125380	Front chopper belt	69.82	69.82
1	QPH125381	Rear chopper belt	65.89	65.89
1	QPH115881	Cyl. belt	187.80	187.80
1	QPH141167	Upper clean grain belt	136.87	136.87
1	HP1015	1/16 X 1 5/16 Hair pin	0.50	0.50
1	AH155480	unload auger swing module	160.70	160.70
2	H84026	J-Hook	0.36	0.72
1	#3057	Bulb	1.58	1.58
2	#194	Bulb	1.15	2.30
1	H214962	Gasket	50.00	50.00
1	AXE16072	Charge Pump	2,463.49	2,463.49
0.75	92506	Washer fluid	3.90	2.93
8.75	#50rc	#50 roller chain	5.97	52.24
13.75	#60rc	#60 roller chain	6.59	90.61
12.75	#60Hrc	#60H Roller Chain	9.62	122.66
2	#50cl	#50 connector link	1.66	3.32
1	#60cl	#60 connector link	1.92	1.92
1	#60HCL	#60H Connector Link	3.42	3.42
1	#60ol	#60 offset link	3.56	3.56
1.0625	85w-140gl	85w-140 gear lube	17.73	18.84
1	Rhino grease	Tube of grease	7.80	7.80
Total				
Payments/Credits				

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/3/2017	311

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over and repair

Serial Number	Terms	Hours	Model
673110	Due on receipt	29471/2062S	9500

Quantity	Item	Description	Price Each	Amount
3	19H2151	1/4 X 3 Bolt		
3	M63707	1/4 Locknut	1.37	4.11
3	E64256	M8 locknut	0.41	1.23
3	19M7185	M8 X 60 Bolt	1.30	3.90
4	1/4 X 3EB	Eye bolt	1.19	3.57
2	Miscellaneous	PVC coated chain	1.41	5.64
84	Milage	Return trip mileage	5.00	10.00
1	Shop Supplies	Shop supplies used for repair	1.00	84.00
1	Shipping	Shipping on Parts	30.00	30.00
50.81	Labor	Labor	116.87	116.87
	Check over discount	Checkover discount (parts and labor over \$1000.00)	80.00	4,064.80
		Checked over combine for needed repairs. Replaced feeder house main floor. Replaced lower clean grain auger and bearings. Replaced rear shoe auger wood blocks. Replaced dual range torque wheel seal. Rebuilt upper cylinder variable sheave cylinder with a new seal and union fitting. Changed primary countershaft gear case oil and welded nut on drain cap for easier removal. Filled washer fluid. Replaced broken brush module rubber strap. Cleaned dirt out from concave stop so concave would close completely. Freed up cleaning fan speed adjuster. Installed hair pin in place of cotter pin for tailings sample door so it would be easily removable. Replaced bulb for left front flasher. Repaired bad connection for right rear amber flasher. Replaced broken right tail light lens. Replaced marker light bulb for right light. Repaired left tail light bulb connection and replaced marker bulb. Repaired bad connection for left rear amber marker light. Replaced bad unload auger swing module to get unload	-280.00	-280.00
Total				
Payments/Credits				

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
7/3/2017	311

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Check over and repair

Serial Number	Terms	Hours	Model
673110	Due on receipt	2947E/2062S	9500

Quantity	Item	Description	Price Each	Amount
		light to work. Put left feeder chain on left sprocket properly after it had jumped the sprocket. Adjusted feeder chain. Changed dual range oil. Welded crack above left feeder drum adjuster. Replaced worn bottom feeder drive chain board. Replaced front shoe auger bearings. Replaced worn through concave nose piece. Replaced all drive chains. Replaced cracked cylinder drive belt. Rebuilt lower cylinder drive variable sheave and adjusted sheave gap. Drilled vent hole in walker gear case hose cap and topped off oil. Replaced front and rear walker bearings with wood blocks. Replaced chopper hammers and rotated rods. Replaced both front and rear chopper drive belts. Changed all hydraulic filters. Replaced rear hydro cable ball joint. Replaced rotary screen belt. Replaced lower rotary screen belt idler pulley. Replaced broken walker plugged sensor magnet. Serviced batteries. Replaced broken engine gear case dipstick. Replaced inner and outer engine air filters. Replaced leaking hyd. pump. Replaced hydro charge pump due to worn splines. Replaced clean grain elevator belt. Made necessary adjustments. Greased combine. Installed duals. Run and checked operation.		
Total				\$12,607.77
			Payments/Credits	-\$12,607.77

Anderson Repair

22302 Kandi-Meeker Rd

Atwater, MN 56209

Phone 320-220-2164

Date	Invoice #
10/26/2016	259

Bill To
Tyler Slinden 17100 Lake Elizabeth Pass Atwater, MN 56209

Work to be done
Look over 9500

Serial Number	Terms	Hours	Model
	Due on receipt		9500

Quantity	Item	Description	Price Each	Amount
2.5	Labor	Labor Looked over 9500 for possible purchase.	80.00	200.00

If you are satisfied please tell your neighbors.
If not please tell Anderson Repair Thank you

Total	\$200.00
Payments/Credits	-\$200.00