



901 West 94th Street  
Minneapolis MN 55420-4236



<b>MINNESOTA</b>	952-888-4121	800-352-2812
<b>IOWA</b>	515-957-3800	800-342-7002
<b>MISSOURI</b>	515-957-3800	800-342-7002
<b>WISCONSIN</b>	515-957-3800	800-342-7002

Page: 1

Sold To: NORTHERN LIGHTS SPECIALIZEDLLC  
47221 225TH AVE  
STAPLES MN 56479-5081

Invoice Number: SW190020036

Date: 4/12/17

Account No.: 0174720

Ship To: PLEASE VERIFY CUSTOMERS ADDRESS

Invoice Information	
WO Number:	WQ13437
WO Date:	3/29/17
Store:	BRAINERD
Payment Terms:	CHARGE
P/O Number:	ROBERTS BLUE TRUCK
Ship Via:	
Invoice Type:	1H1H1H
Make:	CATERPILLAR
Model:	C15
Serial:	0MXS98285
PIN:	
Id No:	
Cust Unit:	
Meter:	1257330.0

Invoice Summary	
Parts:	1,252.85
Labor:	2,414.00
Misc:	490.87
Taxes:	.00
Amount Due:	\$4,157.72
Invoice Total:	4,157.72

**DUE BY 10TH OF THE NEXT MONTH**  
A service charge of 1 1/2 % per month will be assessed on all past due accounts.

To ensure proper credit, please detach this portion, at the perforation, and return with remittance.



NORTHERN LIGHTS SPECIALIZEDLLC  
47221 225TH AVE  
STAPLES MN 56479-5081

Account Number: 0174720  
Invoice Number: SW190020036  
Invoice Date: 4/12/17

Please remit to:  
ZIEGLER INC.  
SDS 12-0436  
PO BOX 86  
MINNEAPOLIS, MN 55486-0436

Amount Due:

Amount Enclosed:



901 West 94th Street  
 Minneapolis MN 55420-4236



MINNESOTA  
 IOWA  
 MISSOURI  
 WISCONSIN

 
952-888-4121 800-352-2812  
 515-957-3800 800-342-7002  
 515-957-3800 800-342-7002  
 515-957-3800 800-342-7002

Invoice Number: SW190020036 Date: 4/12/17 Account No.: 0174720 Page: 2

Quantity	Item	N/R	Description	Unit Price	Extended
REPAIR TRANSMISSION					
CUSTOMER COMPLAINT:					
TRANSMISSION INPUT LEAKING					
CAUSE OF FAILURE:					
INPUT SEAL BAD					
RESULTANT DAMAGE:					
OIL LEAK					
REPAIR PROCESS COMMENTS:					
DRAINED THE OIL. REMOVED THE CROSS MEMBER, THE EXHAUST PIPING, DRIVE LINE, SHIFT TOWER, TRANSMISSION OIL COOLER LINES. PULLED THE TRANSMISSION DOWN. THE TRANSMISSION ALSO HAD A TRANSMISSION OIL COOLER FAILURE, REMOVED THE SHIFT FORK COVER, AND THE BELL HOUSING, REMOVED THE INPUT SHAFT, CLEANED THE TRANSMISSION OUT THE BEST I COULD. INSTALLED THE SHIFT FORK COVER, INPUT SHAFT KIT, AND THE BELL HOUSING. REMOVED THE CLUTCH AND FOUND THE CLUTCH CRACKED. HAD THE FLYWHEEL CUT, REPLACED THE REAR MAIN SEAL, INSTALLED THE FLYWHEEL WITH NEW PILOT BEARING. INSTALLED THE CLUTCH. INSTALLED NEW CROSS SHAFT BUSHING AND SHAFTS. INSTALLED THE TRANSMISSION. HOOK UP ALL THE LINES AND WIRING. INSTALLED THE EXHAUST, CROSS MEMBER, AND THE DRIVE LINE. FILLED THE TRANSMISSION WITH DIESEL FUEL AND RAN FOR A BIT AND DRAIN. FILLED TRANSMISSION WITH OIL AND RAN FOR A BIT AND DRAINED TO FLUSH THE TRANSMISSION OUT. FILLED WITH OIL, WENT ON A TEST DRIVE.					
1	1H-1023		RING	.75	.75
2	1J-9671		SEAL O RING	.79	1.58
1	3E-6760		SEAL O RING	.71	.71
2	6V-8397		SEAL	.85	1.70
10	7K-1181		STRAP CABLE	.31	3.10
1	7X-4805		SEAL O RING	4.02	4.02
1	10R-2356		FLYWHEEL AS	566.82	566.82
1			CORE CHARGE	459.16	459.16
1-	10R-2356		FLYWHEEL AS	566.82	566.82-
1-			CORE CREDIT	459.16	459.16-
1	142-5868		SEAL GP-CSHF	88.19	88.19
1	421-9910		KIT-CLUTCH I	219.15	219.15
1	J009623		SEALCLAMP	14.85	14.85
6	J009624		SEALCLAMP	15.31	91.86
5	P226158F		FLEXTUBE 5INCH SS	21.90	109.50
1	06-00530		X-SHAFT	30.23	30.23
1	K1969		SLEEVE KIT	2.64	2.64
1	S19133		X-SHAFT	34.98	34.98
1	19481		GASKET	2.37	2.37
1	20490		PIN, RANGE SLAVE AN	7.70	7.70
1	21268		SPRING, COMP	.66	.66
2	2507018X		U-JOINT RETAINER KN	17.70	35.40
2	4302676		GASKET, SHIFT BAR N	3.75	7.50
			TOTAL PARTS	SEG. 01	656.89 *
				F/R LBR	2300.00 *
30.00			MISC OIL		360.00
			TOTAL MISC CHGS	SEG. 01	360.00 *
			SEGMENT 01 TOTAL		3316.89 T
-----					
REPAIR TC/TRANS OIL COOLER					



901 West 94th Street  
 Minneapolis MN 55420-4236



MINNESOTA  
 IOWA  
 MISSOURI  
 WISCONSIN

952-888-4121 800-352-2812  
 515-957-3800 800-342-7002  
 515-957-3800 800-342-7002  
 515-957-3800 800-342-7002

Invoice Number: SW190020036 Date: 4/12/17 Account No.: 0174720 Page: 3

Quantity	Item	N/R	Description	Unit Price	Extended
CUSTOMER COMPLAINT: REPLACE TRANSMISSION OIL COOLER CAUSE OF FAILURE: TRANSMISSION OIL COOLER RESULTANT DAMAGE: COOLANT IN THE TRANSMISSION OIL REPAIR PROCESS COMMENTS: REMOVED THE TRANSMISSION COOLER AND INSTALLED A NEW ONE. ONE OF THE COOLANT HOSES WAS BAD SO I REPLACED IT WITH NEW HOSE.					
10	6K-0806		TIE S	.28	2.80
4	174-8903		CUTOFF WHEEL S	1.57	6.28
1	K4244		COOLER N	543.20	543.20
13	80075		HOSE, 3/4 SILICONS	3.36	43.68
			TOTAL PARTS	SEG. 02	595.96 *
				F/R LBR	114.00 *
			SEGMENT 02 TOTAL		709.96 T
-----					
			SERVICE SUPPLIES AND ENVIRONMENTAL CHARGES		130.87 T
TAX EXEMPTION LICENSE 8772215 DUE BY 10TH OF THE NEXT MONTH					
			INVOICE TOTAL		4,157.72