

901 West 94th Street
 Minneapolis MN 55420-4236



MINNESOTA
 IOWA
 MISSOURI
 WISCONSIN

952-888-4121 800-352-2812
 515-957-3800 800-342-7002
 515-957-3800 800-342-7002
 515-957-3800 800-342-7002

Invoice Number: SW520089660 Date: 9/15/18 Account No.: 0092290 Page: 2

Quantity	Item	N/R	Description	Unit Price	Extended
	PAID CHECK #6328 - \$4,250.00 PAID CHECK #1776 - \$2,125.00 COMPLETE PRE-SAFETY CHECK CUSTOMER COMPLAINT: JOB SITE ASSESSMENT COMP				
	SEGMENT AA TOTAL				.00 T

	REPAIR WIRING CUSTOMER COMPLAINT: MACHINE WOULD NOT START NO FUNCTION TO THE BASKET CAUSE OF FAILURE: THE TUBE THAT THE WIRING WENT THROUGH BOUND UP AND PINCHED/CUT WIRES RESULTANT DAMAGE: FUNCTIONS TO THE BASKET WOULD NOT WORK REPAIR PROCESS COMMENTS: RAN A JUMPER WIRE TO THE BASKET AND GOT SOME OF THE FUNCTIONS TO WORK TRIED TO EXTEND THE BOOM TO GET A BETTER LOOK AT SOME OF THE WIRES FOUND THAT THE TUBE THAT THE WIRING AND HYDRAULIC HOSES WENT THROUGH HAD BROKE AND WOULD PINCH THE WIRES WHEN IT WOULD EXTEND. THEN THE MACHINE WAS PUSHED INTO THE SHOP THE WIRING AND HYDRAULIC HOSES WERE LABELED THEN REMOVED FROM THE BASKET THEN IT WAS PULLED THROUGH THE TUBING THE WIRING IN THE CONTROL PANEL WAS LABELED EACH HARNESS WAS REMOVED AND REPLACED SEPARATELY TO MAKE SURE IT WENT BACK IN THE EXACT SAME WAY. CUSTOMER COMPLAINT: BASKET CONTROLS WOULDNT WORK CAUSE OF FAILURE: THE BOLTS AT THE FRONT OF THE OUTER TUBE HAD RUSTED AND CAUSE IT TO SLIDE OFF THE TRACK. THEN IT WAS EXTENDED CUTTING WIRES AND HYDRAULIC LINES RESULTANT DAMAGE: THE WIRING WAS CUT AND HYDRAULIC LINES WERE STRECHED AND CUT TO THE BASKET. MOST OF THE BASKET FUNCTIONS DID NOT WORK REPAIR PROCESS COMMENTS: I TROUBLESHOT THE MACHINE BY PUTTING IN A JUMPER HARNESS IN VARIOUS SPOTS AND REGAINED SOME POWER AND ADDED A NEW KEY SWITCH AND STOP SWITCH. THEN IN THE BASKET SOME OF THE FUNCTIONS WORKED BUT NOT ALL. I TRACED BACK THE WIRING AND FOUND THE CUT WIRES AND HYDRAULIC LINES AT THE REAR OF THE BOOM. ONCE THE MACHINE WAS MOVED INSIDE THE WIRING TO THE BASKET WAS LABLED AS BEST I COULD WITH WHAT WAS THERE AND THE WIRING AND HYDRAULIC LINES WERE REMOVED. THE WIRING AT THE BASE WAS CAREFULLY LABLED. THEN THE TUBES WERE TAKEN OFF AND THE BASE FOR THEM WAS REMOVED. A NEW TUBE WAS ORDERED. THE ELECTRIAL HARNESS WERE MEASURED AND ORDERED AS WELL. ONCE THE TUBE WAS FABRICATED AND READY THE WIRING WAS WIRED INTO THE BASE IT WAS STRUNG OUT WITH THE NEW HYDRAULIC HOSES. THEY WERE SLID INTO THE TUBE BASE AND THAT WAS BOLTED TO THE MACHINE. THE CHAIN THEN WENT UNDERNEATH				

Invoice Number: SW520089660 **Date:** 9/15/18 **Account No.:** 0092290 **Page:** 3

Quantity	Item	N/R	Description	Unit Price	Extended
<p>THE WIRING AND THEN THE CHAIN WAS SNAPPED INTO PLACE MAKING SURE EVERYTHING WASN'T TANGLED. AFTER RUNNING THE WIRES THROUGH THE BOOM I STARTED CONNECTING THEM IN THE BASKET. THE WIRING THAT WAS THERE WAS A MESS AND VERY HACKED UP. I GOT THE BREAD BOARD TYPE OF CONNECTIONS PUT TOGETHER AND MOST OF THE WIRING CONNECTED. WILL TAKE A LOT OF TIRAL AND ERROR TO GET ALL THE FUNCTIONS WORKING.</p> <p>GOT THE STARTING CIRCUIT WORKING IN THE BASKET. HAD TO TRACE ALL THE WIRES IN THE BASKET AND AT THE BASE TO MAKE SURE THEY WERE THE CORRECT ONES. THEN I HAD TO TROUBLSHOOT THE SAFETY FOOT PEDAL IN THE BASKET AND FIGURE OUT WHAT CIRCUIT IT WENT TO AND HOW IT WORKED. ENDED UP RUNNING WIRES BACK TO THE CORRECT SPOT IN THE FOOT PEDAL TO GET IT WORKING FOR THE NORMALLY OPEN CIRCUIT. FOUND OUT THAT SOME SWITCHES WERE BAD CAUSING THE CIRCUIT TO LOSE VOLTAGE WHEN SOME SWITCHES WERE ACTIVATED. AFTER INSTALLING THE NEW MICRO SWITCHES I TRIED IT AGAIN. BUT I HAD NO POWER TO THE FUNCTIONS. I SWITCHED THE WIRING IN THE FOOT PEDEAL AND REGAINED POWER. THEN ALL FUNCTIONS WORKED BESIDES THE FORWARD AND REVERSE. I FIGURED OUT THE ONLY WAY TO MOVE THE BOOM UP WAS TO HIT A TOGGLE SWITCH AND BOOM UP AT THE SAME TIME. I TRACED ALL THE WIRING FROM THE BASKET TO THE BASE THEN FROM THE SOLENOID VALVES THEMSELVES TO THE CIRCUIT BOARD. I THEN MOVED 1 WIRE AND GOT THE FORWARD AND REVERSE FUNCTIONS TO WORK.</p> <p>THE FITTING WAS PUT IN TO THE SWING MOTOR AND THEN WAS TESTED. I ADJUSTED THE ANGLE OF THE FITTING AND IT DOES NOT BIND OR PINCH AND WORKS AT THE BASE ON THE BASKET. THE HYDRAULIC LINES AND WIRING WERE ZIP TIED IN PLACE. I INSTALLED NUT ZERKS FOR THE COVER OF THE BASKET SINCE THE OLD ONES WERE GONE OR STRIPPED. THE WIRING WAS TIED UP AND THE COVER WAS BOLTED DOWN. THE BATTERIES ARE WEAK AND WILL NEED TO BE REPLACED</p> <p>THERE WAS A LOT OF TROUBLESHOOTING TO GET ALL THE FUNCTOINS TO WORK. THE WIRING WAS VERY HACKED AND MOST OF THE WIRING HAD TO BE TRACED ALL THE WAY THROUGH THE MACHINE. ALSO THERE IS NO SOLENOID TO THE SHUT OFF AND THAT HAS TO BE DONE MANUALLY</p>					
8	GE/19712		MICROSWITCH N	7.68	61.44
3	GE/29480		TRACK REPAIR, 7LINK	60.00	180.00
2730	GE/48533		WIRE N	.50	1365.00
1	122512		GN-SERVICE KIT, KEN	42.49	42.49
1	122514		GN-KIT,ESTOP SERV N	25.35	25.35
2	147094		GN-CIRCUIT BREAKERN	4.65	9.30
			TOTAL PARTS	SEG. 01	1683.58 *
				F/R LBR	1504.90 *
3.00			IBF GROUND		68.48
1.00			IBF GROUND		13.60
			TOTAL MISC CHGS	SEG. 01	82.08 *
			SEGMENT 01 TOTAL		3270.56 T

REMOVE & INSTALL ROD/TUBE
CUSTOMER COMPLAINT:
TUBING WAS BENT UP AND WOULD BIND AND CUT WIRES



901 West 94th Street
 Minneapolis MN 55420-4236




MINNESOTA 952-888-4121 800-352-2812
 IOWA 515-957-3800 800-342-7002
 MISSOURI 515-957-3800 800-342-7002
 WISCONSIN 515-957-3800 800-342-7002

Invoice Number: SW520089660 Date: 9/15/18 Account No.: 0092290 Page: 4

Quantity	Item	NR	Description	Unit Price	Extended
<p>CAUSE OF FAILURE: IT RUSTED OUT AT THE FRONT AND THEN BOUND UP CAUSING IT TO CUT WIRES WHEN IT WOULD EXTEND RESULTANT DAMAGE: WOULD NOT WORK PROPERLY AND WOULD CUT WIRES REPAIR PROCESS COMMENTS: THE WIRES AND HYDRAULIC LINES WERE PULLED THROUGH IT THEN I WAS ABLE TO REMOVE THE TUBING. THE BASE FOR THE TUBING WAS REALLY BENT UP AND THE MOUNTING BRACKETS WERE BENT SO THEY WERE HAMMERED BACK AND REWELDED FOR STRENGTH PURPOSES. CUSTOMER COMPLAINT: FUNCTIONS AT THE BASKET WOULD NOT WORK CAUSE OF FAILURE: THE BOLTS AT THE FRONT OF THE OUTER TUBE HAD RUSTED AND CAUSE IT TO SLIDE OFF THE TRACK. THEN IT WAS EXTENDED CUTTING WIRES AND HYDRAULIC LINES RESULTANT DAMAGE: THE FUNCTIONS TO THE BASKET WOULDN'T WORK REPAIR PROCESS COMMENTS: THE TUBING WAS BENT SO A NEW OUTER TUBE HAD TO BE INSTALLED. THEN THE BASE WAS STRAIGHTNED OUT SINCE IT WAS BENT AT BOTH ENDS. A BRACKET WAS CUT OFF THE OLD OUTSIDE TUBE AND WELDED ON THE NEW TUBE. THE MOUNTS FOR THE BASE HAD TO BE STRAIGHTENED AND THEN WELDED FOR STRENGTH. NEW BOLTS WERE USED AT THE FRONT OF THE OUTER TUBE. A NEW WEAR PLATE WAS ADDED SINCE THE OLD WAS WAS COMPLETELY MISSING. THEN I INSTALLED THE NEW HYDRAULIC LINES. EVERYTHING WAS STRUNG OUT AND UNTANGLED. THEN THEY WERE SLID INTO THE BASE THEN RAN TO THE BACK OF THE MACHINE THROUGH THE MAIN TUBE. THEN THE SMALL TUBE WAS SLID IN AND EVERYTHING WAS FISHED THOUGH AND THE PLASTIC PROTECTION CHAIN WAS INSTALLED. MADE AN ACCESS COVER TO GET TO THE INSIDE TUBE FOR THE CHAIN GUARD. ONCE THAT WAS DONE THE CHAIN GUARD WAS EASILY ABLE TO GO ON. AFTER GETTING THE MACHINE MOVING I BOOMED IT ALL THE WAY OUT AND IN. ONCE IT WAS IN IT WENT TOO FAR SO I WELDED A PLATE AND A SUPPORT TO THE REAR OF THE SLIDE PREVENTING IT FROM SLIDING TOO FAR BACK. I HAD TO SPOT WELD AND COOL MY WELDS TO PREVENT ANY DAMAGE TO THE WIRING AND HYDRAULIC HOSES UNDERNEATH. THEN THE TUBE WAS PAINTED BLACK.</p>					
8	247-1913		BALLSTUD	N5	
1	458-9585		PAINT-BLACK	S5	4.14
1	GE/13921		ELBOW	N5	10.01
1	GE/25697		WEAR PAD	N5	7.37
2	GE/28586		HOSE	N5	69.79
1	GE/28588		HOSE	N5	154.74
1	GE/28589		HOSE	N5	154.77
					147.56
			TOTAL PARTS	SEG. 02	732.10 *
1.00			TUBING	F/R LBR	800.00 *
2.00			IBF GROUND		155.99
1.00			IBF GROUND		27.26
					24.44
			TOTAL MISC CHGS	SEG. 02	207.69 *



 901 West 94th Street
 Minneapolis MN 55420-4236



MINNESOTA 952-888-4121 800-352-2812
 IOWA 515-957-3800 800-342-7002
 MISSOURI 515-957-3800 800-342-7002
 WISCONSIN 515-957-3800 800-342-7002

Invoice Number: SW520089660 Date: 9/15/18 Account No.: 0092290 Page: 5

Quantity	Item	N/R	Description	Unit Price	Extended
SEGMENT 02 TOTAL					1739.79 T

REMOVE & INSTALL HOOD SUPPORT					
CUSTOMER COMPLAINT:					
HOOD WOULD NOT STAY OPED					
CAUSE OF FAILURE:					
FAILED SHOCKS AND SHOCK MOUNTS					
RESULTANT DAMAGE:					
HOOD WOULD NOT STAY UP ON ITS OWN					
REPAIR PROCESS COMMENTS:					
OPENED THE HOOD AND SECURED IT. THEN REMOVED THE					
SHOCKS TO THE HOODS AND INSTALLED NEW SHOCK					
MOUNTS THEN INSTALLED NEW SHOCKS. NOW BOTH HOODS					
STAY OPEN ON THEIR OWN					
4	GE/28301		GAS STRUT	N5 16.82	67.28
TOTAL PARTS					67.28 *
SEG. 03					67.28 *
F/R LBR					114.00 *
SEGMENT 03 TOTAL					181.28 T

TRANSPORT					
2.00			TRANSPORT HAUL		450.00
TOTAL MISC CHGS					450.00 *
SEG. 98					450.00 *
SEGMENT 98 TOTAL					450.00 T

SERVICE SUPPLIES AND ENVIRONMENTAL CHARGES					211.56 T
IOWA SALES TAX - 6%					175.21 T
IA LO LABOR CERRO GO					29.20 T
DUE BY 10TH OF THE NEXT MONTH					
INVOICE TOTAL					6,057.60



STATEMENT



901 West 94th Street
Minneapolis MN 55420-4236

MINNESOTA 952-888-4121 800-352-2812 Ext. 5800
IOWA 515-957-3800 800-342-7002 Ext. 3844
MISSOURI 515-957-3800 800-342-7002 Ext. 3844
WISCONSIN 515-957-3800 800-342-7002 Ext. 3844

Date: 12/01/2017 - 12/31/2017 Page: 1

Account: 0092290

Forwarding Service Requested

K WARNEKE FARMS LTD
790 VINE AVE
ACKLEY IA 50601-8541



86889648 - 2180



Statement Summary:

Previous Balance	1,059.38
Payments	
Period Activity	8,125.21
Account Balance	9,184.59 TOTAL

MONTHLY AGING OF OPEN ITEMS

8,125.21	1,059.38	0.00	0.00	0.00	0.00	0.00
CURRENT	1-30 Days Past Due	31-60 Days Past Due	61-90 Days Past Due	91-120 Days Past Due	121-150 Days Past Due	151 + Days Past Due

Part/Service/Rentals due by the 10th of the next month.

Machines net 20 days from invoice date.

A service charge of 1 1/2% per month will be assessed on all past due accounts.

To ensure proper credit, please detach bottom portion and return with remittance.

K WARNEKE FARMS LTD
790 VINE AVE
ACKLEY IA 50601-8541

Account Number: 0092290
Statement Date: 12/31/2017

Amount Due:

Amount Enclosed:

Please Remit To:

ZIEGLER INC.
SDS 12-0436
PO BOX 86
MINNEAPOLIS MN 55486-0436