

1830 - 1910 cart ~~1830~~ -

2023



3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631
Kenmare, ND (701) 385-4227
Minot, ND (701) 852-0767
Mohall, ND (701) 756-6825
Rugby, ND (701) 776-5727
Stanley, ND (701) 628-2120
Velva, ND (701) 338-2828

Williston, ND (701) 572-6724
Beach, ND (701) 872-3737
Bowman, ND (701) 523-3252
Dickinson, ND (701) 225-8123
Elgin, ND (701) 584-2681
Lemmon, SD (605) 374-3373



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE
213 MCKINLEY AVE
PO BOX 144
GOODRICH ND 58444-0144

Bus Phone: (701)884-2632
Prv Phone:

MARK DEMKE
213 MCKINLEY AVE
PO BOX 144
GOODRICH ND 58444-0144

Bus Phone: (701)884-2632
Prv Phone:

Invoice Number: 10824043

Invoice Date: 02/15/2023

Location: 8

Work Order Number: 356860

Payment Type: Finance

Page: 1 of 9

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

/1910_MHGRDDRVFERT Retail

COMPLAINT:

01 Front meter housing is starting to corrode. (AA67290), (A-BOSS20)
METER HOUSING, REPLACE (GROUND DRIVE, FERTILIZER TANK) PER TANK

CORRECTION:

Tech Garret:
Removed Front and middle tank pipes
Removed Single manifold
Removed Meter housing
Removed transition from tank
Installed transition with Stainless
Installed isolator new
Drilled holes for middle bolts on stainless plate
Bolted top plate to tank mount
Silicone and install shutoff slide block
Install shutoff handles onto slides
Installed meter housing
Installed stainless manifold
Installed pipes
Installed speed sensor
Installed clutch assembly
Tested operation

1910 cart


PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
A-BOSS20	STAINLESS METER HOUSING/w 8-GATE SHUTOFF	1.00	6,254.19	\$6,254.19	N
A-SSHOOTKIT	Chute Kit	1.00	1,999.92	\$1,999.92	N
<i>Comment: minot transfer 12-23-22 tr</i>					
A-TRANS415KIT	TANK TRANSITION KIT	1.00	865.83	\$865.83	N
<i>Comment: minot transfer 12-23-22 tr</i>					
PM37465	RTV 587 BLUE SILICONE 80 ML TUBE	1.00	9.12	\$9.12	Y
Miscellaneous	Description	Quantity	Net Price	Extended Price	Taxed Ind
P3750	SHIPPING FREIGHT COST	1.00	0.52	\$0.52	N
<i>Comment: a-a31867, carrier freight</i>					

Labor: \$1,071.00 Parts: \$9,129.06 OL&M: \$0.00 Misc: \$0.52 Sub-Total: \$10,200.58

/1910_MTRCLTCHRECON Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

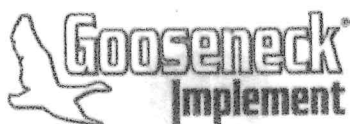

3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631	Williston, ND (701) 572-6724
Kenmare, ND (701) 385-4227	Beach, ND (701) 872-3737
Minot, ND (701) 852-0767	Bowman, ND (701) 523-3252
Mohall, ND (701) 756-6825	Dickinson, ND (701) 225-8123
Rugby, ND (701) 776-5727	Elgin, ND (701) 584-2681
Stanley, ND (701) 628-2120	Lemmon, SD (605) 374-3373
Velva, ND (701) 338-2828	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	Invoice Number: 10824043 Invoice Date: 02/15/2023 Location: 8 Work Order Number: 356860 Payment Type: Finance Page: 2 of 9
--	--	--

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

02 Front meter clutch needs overhauled. Shear pin needs replaced. (11M7017)
INDEPENDENT METER CLUTCH, RECONDITION (WHEN OFF) (PER METER)

CORRECTION:

Tech Garret:
Disassemble, inspect, clean and replace parts, as required.

<u>PartNumber</u>	<u>Description</u>	<u>Quantity</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
11M7017	COTTER PIN	6.00	0.35	\$2.10	Y
A60792	SPRING	1.00	33.09	\$33.09	N
A82596	Seal	2.00	19.88	\$39.76	N
H103264	PRESSED FL	4.00	2.36	\$9.44	N
JD8562	BALL BEARI	2.00	18.34	\$36.68	N
JD8563	ECCENTRIC	2.00	11.26	\$22.52	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
P3750	SHIPPING FREIGHT COST	1.00	2.38	\$2.38	N
Comment: a45890,carrier freight					

Labor: \$153.00	Parts: \$143.59	OL&M: \$0.00	Misc: \$2.38	Sub-Total: \$298.97
-----------------	-----------------	--------------	--------------	---------------------

/1910_MTRDRVBUSH Retail

COMPLAINT:

03 Rear meter drive bushing needs replaced. (A814444 x 2), (A59677)
METER HOUSING DRIVE BUSHING, REPLACE (PER METER HOUSING)

CORRECTION:

Tech Garret:
Removed agitator arm
Removed worn seals
Replaced meter housing seals
Replaced drive shaft and roll pin

<u>PartNumber</u>	<u>Description</u>	<u>Quantity</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
34M7217	SPRING PIN	1.00	1.20	\$1.20	Y

CONTINUED ON NEXT PAGE->



3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631	Williston, ND (701) 572-6724
Kenmare, ND (701) 385-4227	Beach, ND (701) 872-3737
Minot, ND (701) 852-0767	Bowman, ND (701) 523-3252
Mohall, ND (701) 756-6825	Dickinson, ND (701) 225-8123
Rugby, ND (701) 776-5727	Elgin, ND (701) 584-2681
Stanley, ND (701) 628-2120	Lemmon, SD (605) 374-3373
Velva, ND (701) 338-2828	



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	Invoice Number: 10824043 Invoice Date: 02/15/2023 Location: 8 Work Order Number: 356860 Payment Type: Finance Page: 3 of 9
--	--	---

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

A59677	SPACER	1.00	28.16	\$28.16	N
<i>Comment: rugby transfer 12-23-22 tr</i>					
A82567	BUSHING	2.00	25.51	\$51.02	N
A86501	PIN FASTENER	1.00	50.19	\$50.19	N

Labor: \$153.00 Parts: \$130.57 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$283.57

1910F871293 Retail

COMPLAINT:

04 The 2 green meters need to be replaced. Severely corroded and the housing are wore out. Both shafts are worn. Can not disassemble. METER CARTRIDGE - BA29096 HIGH-RATE (GREEN) time is for tuning the 2 new meter rollers.

CORRECTION:

Tech Kelly:
NO TUNING NEEDED - METER ROLLER WAS INSTALLED AS IS - DO NOT BILL LABOR

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
BA29096	Non-SectionCommand Meter Roller - High R	2.00	1,571.90	\$3,143.80	N

Labor: \$0.00 Parts: \$3,143.80 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$3,143.80

Segment 5 Retail

COMPLAINT:

05 Yellow meter needs a new Seal


CORRECTION:

Tech Tony:
Replaced Seal on Yellow meter only

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
A59302	SEAL	1.00	23.78	\$23.78	N

Labor: \$76.50 Parts: \$23.78 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$100.28

CONTINUED ON NEXT PAGE->



3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631
Kenmare, ND (701) 385-4227
Minot, ND (701) 852-0767
Mohall, ND (701) 756-6825
Rugby, ND (701) 776-5727
Stanley, ND (701) 628-2120
Velva, ND (701) 338-2828

Williston, ND (701) 572-6724
Beach, ND (701) 872-3737
Bowman, ND (701) 523-3252
Dickinson, ND (701) 225-8123
Elgin, ND (701) 584-2681
Lemmon, SD (605) 374-3373



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE
213 MCKINLEY AVE
PO BOX 144
GOODRICH ND 58444-0144

Bus Phone: (701)884-2632
Prv Phone:

MARK DEMKE
213 MCKINLEY AVE
PO BOX 144
GOODRICH ND 58444-0144

Bus Phone: (701)884-2632
Prv Phone:

Invoice Number: **10824043**
Invoice Date: 02/15/2023
Location: 8
Work Order Number: 356860
Payment Type: Finance

Page: 4 of 9

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

/1910_METERCHAIN Retail

COMPLAINT:

06 SEED METER ROLLER CHAIN, & GROUND DRIVE CHAIN REPLACE (PER CHAIN)

CORRECTION:

Tech Tony:
Removed old chain
Cut new chain to length
Installed and tension chain

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
AJ8878N	LINK CHAIN	306.00	0.18	\$55.08	N
SW40COUS	40 CONNECTOR LINK	3.00	2.17	\$6.51	N
SW40OLUS	CHAIN LINK	1.00	3.99	\$3.99	N
SW40X50US	40 ROLLER CHAIN, 50FT	168.00	0.31	\$52.08	N

Labor: \$191.25 Parts: \$117.66 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$308.91

/1910_AUGBEARUPPER Retail

COMPLAINT:

07 Commodity fill system: The 2 bearing on the top of the conveyer roller need to be replaced. (JD8665)
UPPER CONVEYOR AUGER BEARINGS, R&R

CAUSE:

top bearings tight and seized up

CORRECTION:

Tech Kelly:
swung conveyor out
brought top end down to the ground
removed cover
unbolted and removed hydraulic motor
removed coupler chain and drive motor sprocket
removed sprocket from belt shaft using a puller

CONTINUED ON NEXT PAGE->



3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631
Kenmare, ND (701) 385-4227
Minot, ND (701) 852-0767
Mohall, ND (701) 756-6825
Rugby, ND (701) 776-5727
Stanley, ND (701) 628-2120
Velva, ND (701) 338-2828

Williston, ND (701) 572-6724
Beach, ND (701) 872-3737
Bowman, ND (701) 523-3252
Dickinson, ND (701) 225-8123
Elgin, ND (701) 584-2681
Lemmon, SD (605) 374-3373



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE
213 MCKINLEY AVE
PO BOX 144
GOODRICH ND 58444-0144

MARK DEMKE
213 MCKINLEY AVE
PO BOX 144
GOODRICH ND 58444-0144

Bus Phone: (701)884-2632
Prv Phone:

Bus Phone: (701)884-2632
Prv Phone:

Invoice Number: **10824043**

Invoice Date: 02/15/2023

Location: 8

Work Order Number: 356860

Payment Type: Finance

Page: 5 of 9

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

removed adjustment bolts
unbolted adjustment brackets
removed bearing locking collars
removed brackets from belt shaft
removed belt pulley
cut bearings off of the shaft
cleaned the shaft ends up
re-installed belt pulley
installed new bearings and bearing flanges into the adjustment bracket with new hardware
installed bracket and bearing onto conveyor and belt pulley
centered pulley and installed locking collars
installed sprockets and chain onto pulley
installed drive motor
ran conveyor and adjust belt to run in the center of the pulley
tightened down adjustment blocks
installed cover
swung conveyor back into conveyor saddle

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
03M7185	BOLT	8.00	0.41	\$3.28	Y
14M7396	LOCK NUT	8.00	1.08	\$8.64	Y
80050	clear rtv sil1co.	1.00	6.94	\$6.94	N
JD8554	ECCENTRIC	2.00	6.67	\$13.34	N
JD8665	BALL BEARI	2.00	15.04	\$30.08	N
M66125	PRESSED FL	4.00	1.45	\$5.80	N
RE12363	CONNECTOR	1.00	1.87	\$1.87	N
SW50DCOUS	CHAIN LINK	1.00	4.89	\$4.89	N

Labor: \$612.00 Parts: \$74.84 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$686.84

Segment 8 Retail

COMPLAINT:

08 Front right inner tire needs to be repaired or replaced

CORRECTION:

Tech Dakotah:
removed he 6 lug nuts
removed old wheel
installed new tire

CONTINUED ON NEXT PAGE->



3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND	(701) 324-4631	Williston, ND	(701) 572-6724
Kenmare, ND	(701) 385-4227	Beach, ND	(701) 872-3737
Minot, ND	(701) 852-0767	Bowman, ND	(701) 523-3252
Mohall, ND	(701) 756-6825	Dickinson, ND	(701) 225-8123
Rugby, ND	(701) 776-5727	Elgin, ND	(701) 584-2681
Stanley, ND	(701) 628-2120	Lemmon, SD	(605) 374-3373
Velva, ND	(701) 338-2828		



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	Invoice Number: 10824043 Invoice Date: 02/15/2023 Location: 8 Work Order Number: 356860 Payment Type: Finance Page: 6 of 9
---	---	--

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

torqued wheels to 130 ft-lbs
strapped old tire to hitch

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
BA30764	33 - 15.5 In. - 16.5 10PR Flotation Ti	1.00	1,248.50	\$1,248.50	N

Labor: \$153.00 Parts: \$1,248.50 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,401.50

/1830_WHLHUBBEARING Retail

COMPLAINT:

09 The rear transport wheels need the pivot bearings replaced. (See attached)
REPLACE BOTH SIDES OF TRANSPORT PIVOT BEARINGS.


CAUSE:

inner bushing and bearing race were worn down on both left and right side
bearings wearing out

CORRECTION:

Tech Dakotah:
removed lug nuts from both inner and outer wheels
removed spring and spring bracket from walking beam
unbolted walking beam from center frame
removed seal from both sides of walking beam
removed spacer from one side of beam
removed old bearing from side of beam
removed bushings with second bearing at once
cleaned out old grease
hammered out both old bearing races
set new bearing races inside of walking beam
installed new bearing and seal on one side
installed new bushings and bearing
installed new seal
jacked walking beam up into rear wheel brackets
bolted walking beam into bracket
torqued to 500 ft-lbs
reattached spring and bracket to walking wheel
reattached inner and outer wheel
torqued to 130 ft lbs
repeated on right hand side pivot wheels

CONTINUED ON NEXT PAGE->

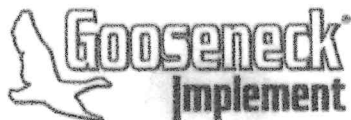

3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631
Kenmare, ND (701) 385-4227
Minot, ND (701) 852-0767
Mohall, ND (701) 756-6825
Rugby, ND (701) 776-5727
Stanley, ND (701) 628-2120
Velva, ND (701) 338-2828

Williston, ND (701) 572-6724
Beach, ND (701) 872-3737
Bowman, ND (701) 523-3252
Dickinson, ND (701) 225-8123
Elgin, ND (701) 584-2681
Lemmon, SD (605) 374-3373



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144	MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144	Invoice Number: 10824043
Bus Phone: (701)884-2632	Bus Phone: (701)884-2632	Invoice Date: 02/15/2023
Prv Phone:	Prv Phone:	Location: 8
		Work Order Number: 356860
		Payment Type: Finance
		Page: 7 of 9

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
A31871	Lock Nut	2.00	6.10	\$12.20	N
A60151	Spacer	2.00	89.11	\$178.22	N
Comment: regina machine down 12-23-22 tr					
A83982	Bolt	2.00	31.44	\$62.88	N
Comment: regina machine down 12-23-22 tr					
AA99572	CONTROL	1.00	1,584.30	\$1,584.30	N
B31312	SEAL	1.00	23.42	\$23.42	N
Comment: rugby transfer 12-23-22 tr					
JD8237	BEARING CU	4.00	5.60	\$22.40	N
Comment: velva transfer 12-23-22 tr					
JD8902	BEARING CO	4.00	13.17	\$52.68	N
Comment: minot transfer 12-23-22 tr					
N187483	ROUND RETA	4.00	23.18	\$92.72	N
Comment: rugby transfer 12-23-22 tr					
N233064	SPACER	2.00	33.22	\$66.44	N
Comment: rugby transfer 12-23-22 tr					
N233301	SPACER	4.00	17.55	\$70.20	N
Comment: rugby transfer 12-23-22 tr					
TY26101	BRAKE AND PARTS CLEANER	2.00	8.01	\$16.02	Y
TY6341	SD POLYUREA GREASE, 14OZ:	1.00	6.92	\$6.92	Y
Miscellaneous	Description	Quantity	Net Price	Extended Price	Taxed Ind
P3750	SHIPPING FREIGHT COST	1.00	47.74	\$47.74	N
Comment: a60151,a83982,carrier freight					

Labor: \$918.00 Parts: \$2,188.40 OL&M: \$0.00 Misc: \$47.74 Sub-Total: \$3,154.14

/DIAG ELECTRICAL Retail

COMPLAINT:

11 Seed blockage need trouble shooting. Cannot bring up the ECU for the seed blockage system.
DIAGNOSTICS-ELECTRICAL SYSTEM

CORRECTION:

Tech Tony:
Back probed at ECU power input 12 volts- OK
Checked Can voltage - OK
ECU will not come online
Ordered new ECU

CONTINUED ON NEXT PAGE->



3117 Highway 52
Harvey, ND 58341
Phone: (701) 324-4631
www.gooseneckimplement.com

Harvey, ND (701) 324-4631
Kenmare, ND (701) 385-4227
Minot, ND (701) 852-0767
Mohall, ND (701) 756-6825
Rugby, ND (701) 776-5727
Stanley, ND (701) 628-2120
Velva, ND (701) 338-2828

Williston, ND (701) 572-6724
Beach, ND (701) 872-3737
Bowman, ND (701) 523-3252
Dickinson, ND (701) 225-8123
Elgin, ND (701) 584-2681
Lemmon, SD (605) 374-3373



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 6001426

Deliver To:

MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	MARK DEMKE 213 MCKINLEY AVE PO BOX 144 GOODRICH ND 58444-0144 Bus Phone: (701)884-2632 Prv Phone:	Invoice Number: 10824043 Invoice Date: 02/15/2023 Location: 8 Work Order Number: 356860 Payment Type: Finance Page: 8 of 9
--	--	--

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 1910	450	1A81910HHAD740131	HAD740131	

INSTALLED AND PROGRAMED ECU
CONFIGURED TO DRILL - OK

Labor: \$459.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$459.00

/DIAG_MISC Retail

COMPLAINT:

12 DIAGNOSTICS CENTER TANK METER DOES NOT READ SPEED/RATE

CORRECTION:

Tech Dakotah:
Tested speed sensor and found it not reading
adjusted gap- still not reading
removed old sensor and installed new
adjusted gap
tested - OK

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Inc
AA92694	Wheel Speed Sensor	1.00	304.34	\$304.34	N

Miscellaneous Charges:

Service Accessory Charge \$75.00

Labor: \$153.00 Parts: \$304.34 OL&M: \$0.00 Misc: \$75.00 Sub-Total: \$532.34

Finance Information

Customer PO No:	Type: Farm Plan	Auth No: 78072	Labor:	\$3,939.75
Tax Exempt No: 1	Merchant No: 55000250		Parts:	\$16,504.54
Advisor: JEFFREY SCHIMKE	Card No: xxxxxxxxxxxx8613		OL&M:	\$0.00
	Bill Code: 785 - PERFORMAX INSPECTION -		Misc:	\$125.64
	Credit Plan: 12015 - SEEING NO PAYMENTS/NO		Sales Tax:	\$2.36
		INTEREST WAIVER UNTIL	Total:	\$20,572.29
		NOVEMBER 15, 2023		

CONTINUED ON NEXT PAGE->

RusTyre®
1021 Divine Ave
Harvey, ND 58341 US
701-693-6652

Invoice

BILL TO

MARK DEMKE
213 McWhorter Ave
P.O. Box 144
Goodrich, ND 58444

1910 cart

INVOICE #	DATE	TOTAL DUE	DUE DATE	TERMS	ENCLOSURE
3778	06/11/2023	\$2,100.00	07/11/2023	Net 30	

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
04/02/2023	TIRES	16.5/16.1 AMER FAR	3	600.00	1,800
04/02/2023	MTG	16.5/16.1	3	100.00	300
BALANCE DUE					\$2,100