



## Inspection Summary Report

### Nelson Motors & Equi

Inspection: 002205	4WD Wheel & Track Tractor Greenlight Inspection	Location: Estevan
General		
Stock Number: 096849	Make: JD	Model: 9RX 590
Description: 9RX 590HP 4TRACK TRACTOR		Year: 2023
Serial Number: 1RW9590DLPJ822511		
Customer Name: DUANE FORRESTER PROPERTIES		
Hour Meter: 940	Hour Meter Works: Yes	
2nd Hour Meter: 0	Original Meter: Yes	
Reference Hours: 0		

#### Machine Information

Verify Machine Serial Number Matches Work Order: Ok

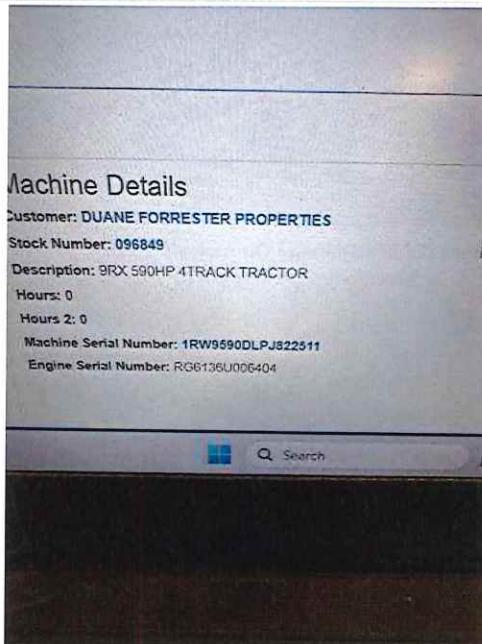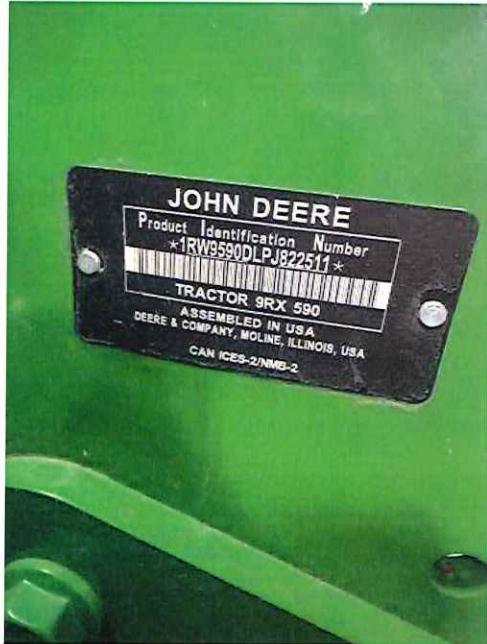

Record Work Order Number Here: Ok

Riley J. Mann, 10/30/2025  
U29071-01

Record Engine Hours on Work Order & Inspection: Ok




## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan

### Machine Information

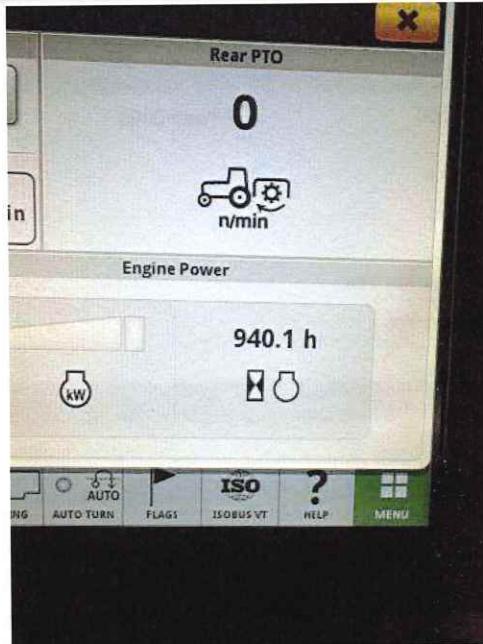

### Preliminary Inspection

Appearance And/Or Damage On Arrival: Good



All Shields Present: Yes

Basic Warranty Remaining Yes/No (Expiration Date ddMMMyyyy): No

Emissions Warranty Remaining Yes/No (Expiration Date ddMMMyyyy): Yes

PowerGard Extended Warranty Remaining PowerTrain/Comprehensive (Expiration Date ddMMMyyyy): No

Limited Basic Warranty Remaining Yes/No (Expiration Date ddMMMyyyy): Yes

Outstanding Safety or Mandatory PIP's: Yes


## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan


### Preliminary Inspection

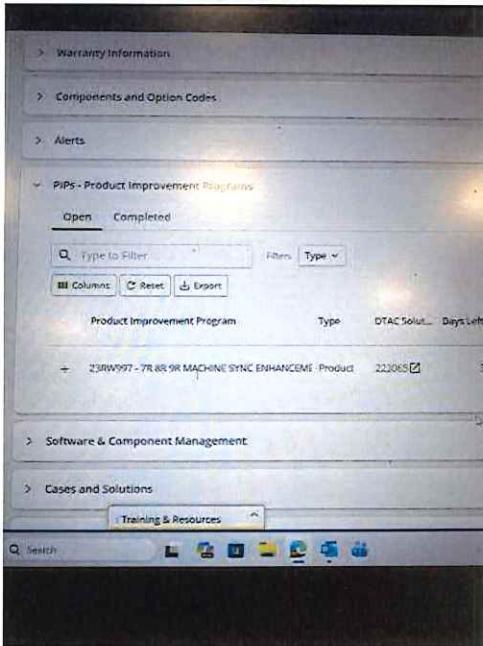

Riley J. Mann, 10/30/2025  
1 non mandatory pip

- ✓ Check & Record Stored Codes (attach print of codes): No Codes

Machine Software Versions (All Versions Current): Old SW

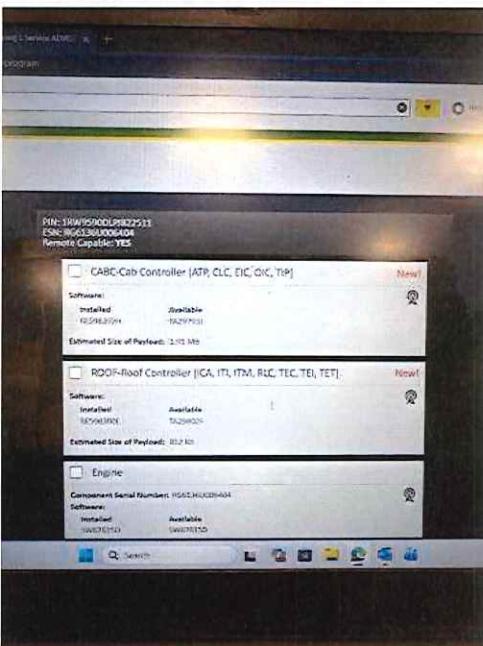

Riley J. Mann, 10/30/2025  
2 new software. CAB and ROOF controllers

- ✓ AMS Software Versions Current (Display & Receiver if Supplied): Current
- ✓ Verify JDLink and SAR: Yes
- ✓ Operate To Check For Abnormal Noises And Heating: Good
- ✓ Verify Engine Speeds: Good

## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan

### Preliminary Inspection

- Headlights: Good
- Field Lights: Good
- Turn Signals & Flashers: Good
- Instrument Lights/Indicator Display Lights: Good
- Park Brake Operations (Place machine on incline to test functionality): Ok
- Service Brakes (Operation & Pedal Travel): Ok
- Wheel Speed Sensor (full speed, erratic, accurate reading): Good
- Radar/GPS Speed: Good
- Mirrors (missing, cracked, power options if equipped)): Good
- HVAC Operation (Heater & A/C): Good
- Blower Motor Operation (Low Output/Noisy): Good
- Pressurizer Motor Operation (Low Output/Noisy): Good
- Neutral Start System: Ok
- Armrest/Shift & Function Levers (Condition, Operation): Good
- Refrigerator Operation: Good
- Greenstar Display (Touch-screen Protector, Operation): Good
- Check Add-ons, Radio, Displays, Etc.: Good
- On Board Diagnostics (non JDLink Equipped Machines) - Record Codes: Good
- Complete Grease Job Of All Grease Points After Operating (Zerks Took Grease): Yes
- Steering (Turns Freely Lock To Lock): Good
- Cab Door Latch & Adjustment: Good
- Cabin Pressure: Good
- Seat Operation (Functions/Operators Presence Switch): Good
- Seat Belt: Ok
- Radio & Speakers: Good
- ⚠ Cabin Air Filter(s) (Condition/Service Life): Average  
Riley J. Mann, 10/30/2025  
Filters aren't too bad but should be replaced
- Evaporator & Heater Core (Signs of Plugging): Good
- Wipers & Washers: Good
- Wiper Blade Condition: Good
- Operators Manual Present: Yes
- Horn Operation: Good
- Rear Window (Latch/Seal/Condition): Good
- Cab Glass & Seals (Condition/Cracked/Chipped/Leaking): Good
- Upholstery & Trim (Condition/Rips/Broke): Good
- Air Vent Louvres (Missing/Broke): Good
- ⚠ Recommend Fluid Test Kit - TY26859 (If not already customer approved): Yes
- General Condition: Good

### Engine

- Check Oil Level: Ok

## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan

### Engine

- Engine Oil Change Due: No
- Check Air Filters: Good
- Check Air Intake System Components, Clamps & Hoses (Spray Externally with Ether): Good
- Check Turbo For Visible Leaks & Noise: Good
- Exhaust System Components including Aftertreatment (if equipped) (Leaks, Clamps, Flanges, Hardware): Good
- DPF Replacement Service Interval: Not Due
- Suggest Yearly DPF Regen: Yes
- Engine/DPF Heat Shields Intact & Positioned Correctly: Good
- Visibly Inspect Head Gasket Leaks or Bolts Broken: Good
- Valve Lash Adjust Service Interval: No Due
- Crankshaft Damper Replacement Service Interval: Not Due
- Fluid Leaks In Engine Area: Good
- Pulleys And Tensioners Noisy Or Worn: Good
- Alternator Output Test: V & A Ok
- Alternator Belt(s), (Condition And Tension, Idler/Tensioner): Good
- A/C Compressor Belt, (Condition And Tension, Idler/Tensioner): Good
- A/C Compressor (Clutch, Leaks, Noisy): Good
- Engine Fan Belt, Condition And Tension: N/A
- Crankcase Vent & Tube, Clean: Good
- DEF Dosing Filter (Annual Change): Yes
- Fan Drive Assembly (Operation, Leakage, Excess Play): Good
- Fan Driven Assembly (Operation, Leakage, Excess Play): Good
- Engine Mounts/Isolators (Condition/Cracked/Hardware): Good
- General Condition: Good

### Cooling System

- Radiator Cap (Condition/Pressure Test/Service Interval): Good
- Radiator (Leakage, Dirty/Plugged, Fins Bent): Good

Riley J. Mann, 11/03/2025  
All of Cooling package should be cleaned out good

- A/C Condenser (Leakage, Dirty, Plugged, Fins Bent): Good
- Hoses & Clamps (Tight, Leakage, Condition): Good
- Coolant (Condition/Freeze Point): Good
- Coolant Level: Good
- Thermostats Operation & Service Interval: Ok
- Block Heater, Operation, Leaks And Cord: Good
- Cooling Package (Lines/Clamps/Leaks/Hardware): Good
- Water Pump (Condition/Leaks/Weep Hole): Good
- General Condition: Good

### Fuel System

- Fuel Leaks, Inspect Lines And Injectors: Good
- Fuel Tank And Sump, Inspect And Drain Off Any Water: Good

## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan

## Fuel System

- Fuel Strainers, Clean Or Replace: Good
- Fuel Filter Service Life: Ok
- Transfer Pump Operation And Pressure: Good
- Any Engine Misfire Or Abnormal Noises: Good
- Fuel Injection Pump (Leaks/Condition): Good
- General Condition: Good

## Electrical System

- Battery Condition And Load Test: Good
- Battery Cables And Ends: Good
- Battery Box And Holdowns: Good
- Starter Operation, Noises Or Drag: Good
- Presence of Starter Terminal Guard: Ok
- Cold Starting Aid if Equipped: N/A
- Wiring Harnesses (corrosion, breaks, melting, secure): Good
- General Condition: Good

## Powertrain

- Park Brake/Park Lock Operation: Ok
- Shift Linkage (Operation, Condition, Excess Play, Adjustment)): Good
- Transmission Operational Checks: Good
- Transmission Clutch Circuit Leak Test: Good
- Transmission Lube Pressure: Good
- Transmission System Leak Test: Good
- Transmission System Pressure: Good
- Transmission Two Speed Leak Test: N/A
- Transmission/Hydraulic/Axle Oil Level: Good
- Transmission/Hydraulic/Axle Oil (Condition, Service Life): Good
- Transmission/Hydraulic/Axle Oil Filter(s) (Condition, Service Life): Good

Riley J. Mann, 11/03/2025  
Hours close

- Telescoping Driveshafts (Condition, Vibration, U-Joints): Good
- Lower Driveline Bearings and Shaft: Good
- PTO (Operation): Good
- PTO Driveshaft(s) (Noise, Vibration, U-Joints): Good
- PTO Clutch (Smooth Engagement, Noise): Good
- PTO Brake Operation: Good
- Transmission Driveline Damper (Condition, Vibration): Good
- Axle Bearing Play: Good
- Differential Lock Operation: Good
- General Condition: Good

## Chassis

- Handrails (Loose, Hardware Missing): Good

## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan

## Chassis

- Fenders: Good
- Machine Frame (Cracks, Weld Cracks): Good
- Hardware (Loose Or Missing): Good
- Drawbar & Support (Condition, Hardware): Good
- Gudgeon Bearing (If Equipped): Good
- Tires or Tracks (Wear/Cracks/Condition): Good
- Safety Decals & Slow Moving Vehicle Sign as per OM (Present/Condition): Ok
- Styling Decals (Condition/Appearance/Missing): Good
- Fire Extinguisher(s) (If equipped): Good

Wheeled Tractor Outer Drive Wheel Hardware (Proper Torque, Loose, Missing): N/A

Wheeled Tractor Inner Drive Wheel Hardware (Visibly Loose, Missing): N/A

- Cab Body (Mounts/Glass): Good
- General Condition: Good

## Hydraulic &amp; Hitch Systems

- Hydraulic Oil (Condition/Level/Service Interval): Ok
- Hydraulic Filters / Strainers (Leaks/Service Interval): Ok
- Hydraulic Oil System Vent Filter: Good
- Oil Reservoir (Leaks/Cracks/Worn): Good
- Oil Cooler (Leaks/Cracked/Worn/Plugged/Fins Bent): Good

Riley J. Mann, 11/03/2025  
Could be blown out

- Hoses/Lines/Fittings (Leaks, Cracks, Secure, Worn): Good
- Hydraulic Pump(s) (Leaks/Mounting): Good
- Hydraulic Pump Pressure (Standby & Stall Pressure in Tech. Manual): Good
- Hydraulic Pump Flow from SCV: Good
- Steering (Relief Pressure/Leaks): Good
- Selective Control Valve (Operation, Cycle Tests, Lines & Clamps, External Leaks): Good

Hitch Sensor(s) (Linkage, Operation): N/A

Hitch Center Link and Lift Links: N/A

Rockshaft/EH Hitch (Operation, Cycle Tests, Adjustments, External Leaks): N/A

- General Condition: Good

## Steering &amp; Brakes

- Hinge Pins (Condition, Excess Play): Good
- Manual Brake Operation: Ok
- Steering Cylinders & Hoses: Good
- Steering Operation: Good
- Steering Pins (Condition, Excess Play): Good
- Steering Valve (Leaks, Mounted Securely): Good
- General Condition: Good

## Tracks Only

- Accumulator Pre-Charge Check: Ok

## Inspection Summary Report

Inspection: 002205

4WD Wheel &amp; Track Tractor Greenlight Inspection

Location: Estevan

Tracks Only

- Brake Operation: Ok
- Drive Wheels (Condition): Good
- Drive Wheels Mounting Hardware (Proper Torque, Missing): Good
- Drive Wheels Oil Level: Good
- Idlers: Good
- Idlers Mounting Hardware (Missing, Loose): Good
- Idlers Oil (Level, Condition): Good
- Undercarriage Frame and Mid Frame: Good
- Mid-Rollers (Condition): Good
- Mid-Rollers Mounting Hardware (Loose, Missing): Good
- Mid-Rollers Oil (Level, Condition, Service Life): Good
- Steering Drift Test as Per Service Advisor: Good
- Steering Filter (Condition, Leaks, Service Life): Good
- Steering Pump/Motor Hoses (Condition, Leakage): Good
- Steering Operation: Good
- Steering Valve (Leaks, Mounted Securely): Good
- Tracks (Condition, Damage, Wear): Good
- Track Alignment: Good

! Track Cylinder Tension (Recommend Annual Tensioning): Yes

Walking Beam Air Suspension: N/A

Walking Beam Air Suspension Filter: N/A

Walking Beam Bumpers: Good

General Condition: Good

### AMS Components - If Customers Components Are Supplied

- Steering Angle Sensor (Functionality): Good
- Priority Valve (Leaks/Functionality): Good
- Parallel Tracking (Functionality): Good
- AutoTrac System (Functionality If Components Are Supplied): Good
- Starfire Receiver (Functionality If Supplied): Good
- General Condition: Good

### Overall Condition

General Condition: Good

Customer Signature: \_\_\_\_\_

Inspector Signature: \_\_\_\_\_