

8120

2004 JOHN DEERE 8120 TRACTOR SGB PST MFWD
NW81209024551

Overview Maintenance Diagnose & Repair

FRANKLIN KVENDRU

1711 640TH ST
BELVIEW, MN 562143050
(507) 938-4494

> Conversation History

> Customer Notes

Machines (13)

> Warranty Information

2 Expired

Components and Option Codes

Components Option Codes

Q

Showing 5 of 5 items

88 Columns Reset Export

Serial Number	Component ↑	Created
HG5051H245371	ENGINE (DEERE MANUFACTURED)	May 28, 2004
ROAH8QCB28912	FRONT WHEEL DRIVE, MECHANICAL	May 28, 2004
RW5G074017353	SOUND-GARD BODY	May 28, 2004
ROTD168088844	TRANSMISSION	May 28, 2004
9C55 AE04C035	VALVE, RC SELECTIVE CONTROL VALVE	May 28, 2004

> Alerts

> PIPs - Product Improvement Programs

> Cases and Solutions

> Manuals and Instructions

> Aftermarket Recommendations

> Work Orders

> Tickets

> Machine Notes

2004 JOHN DEERE 8120 TRACTOR SGB PST MFWD
RW8120P024561

Overview Maintenance Diagnose & Repair

FRANKLIN KVENDRU

1711 640TH ST
BELVIEW, MN 562143050
(507) 938-4494

> Conversation History

> Customer Notes

Machines (13)

> Warranty Information

2 Expired

> Components and Option Codes

Components Option Codes

Q

Showing 21 of 21 items

88 Columns Reset Export

Code	Description	Created
0271RW3589	SGB WINTAR DELUXE	---
0271RW1605	GREENSTAR READY HINSS W/MPL	---
0271RW1200	STANDARD COMFORT PACKAGE	---
0271RW2300	THREE REM CYLINDER CONTROLS	---
0271RW2410	INDEPENDENT PTO-1000 RPM	---
0271RW2539	R5 WHITCH/CAT3/3N/12300 LBS	---
0271RW2800	33.5GPM HYD PUMP	---
0271RW5009	REAR AXLE (110MM) 118.5 IN	---
0271RW4206	2 CAST WA480/60R46 158AB R1W	---
0271RW4906	2 STL WA480/60R46 158AB R1W	---
0271RW5021	MECHAN. FRONT WHEEL DRIVE	---
0271RW6204	380/65R34 137AB R1W MH	---
0271RW5016	FRONT FENDERS F/MPWD (460MM)	---
0271RW3029	ETHER STARTING AID	---
0271RW3109	AM-FM STEREO RADIO W/4 SPEAK	---
0271RW9154	INSTRUCTIONAL SEAT	---
0271RW9188	ENGINE BLOCK HEATER - 110VG	---
0271RW9194	ANTENNA F/BUSINESS BAND	---
0271RW9266	2 PR INS/WHL WGTS-450 LB	---
0271RW9360	VIDEO TAPE ENGLISH	---
0271RW9388	NO TIRE BRAND PREFERENCE	---

> Alerts

> PIPs - Product Improvement Programs

> Cases and Solutions

> Manuals and Instructions

> Aftermarket Recommendations

8120

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
 36648 U.S. Highway 71
 Redwood Falls, MN 56283
 Phone: 507-644-3571
www.kibbleeq.com

**JOHN DEERE**

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 3910541 Invoice Date: 8/28/2023 Location: 82 Work Order Number: 730620 Payment Type: Check Page: 1 of 3
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3492 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

Kibble//Repair Retail**COMPLAINT:**

01 Customer requested repair work order:

CORRECTION:

****ALL AND ANY REPAIRS, QUOTES, AND POSSIBLE DELIVERY TIME FRAMES ARE TO BE COMMUNICATED WITH CUSTOMER.**

****PLEASE ASK AND RECORD CUSTOMER'S Preferred Payment method**

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
----------------------	----------------------	-------------------------	---------------------	--------------------------

Gen2- Retail**COMPLAINT:**

02 TROUBLESHOOT #3 SCV CHECK OPERATION
 INSTALL NEW OUTER SEALS IN THE REST OF THE SCV,S
 RE186599 G0904

CORRECTION:

JS

connected flow meter to SCV and heated system to operating temp
 monitored flow and it was constant with no problems
 used scv on a hydraulic cylinder trying to get SCV to act up but couldn't
 heated oil hotter and pressure checked the scv and it held
 called customer and discussed potential repair
 agreed to leave it alone until it acts up more often
 removed covers on valves 1 and 2
 removed hose tip seals and installed new
 installed covers
 washed off worked area

CONTINUED ON NEXT PAGE->



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 3910541 Invoice Date: 8/28/2023 Location: 82 Work Order Number: 730620 Payment Type: Check Page: 2 of 3
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3492 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

Gen2- Retail

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE186599	SCV Seal Kit, Black & Orange	4.00	9.74	9.74	\$38.96	N
Labor: \$387.20	Parts: \$38.96	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$426.16		

Gen3- Retail

COMPLAINT:
03 REPLACE FUEL FILTER

CORRECTION:
Fuel filters R&R

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE522688	*2M.FUEL FILT*SECONDARY	1.00	47.12	47.12	\$47.12	N



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 3910541 Invoice Date: 8/28/2023 Location: 82 Work Order Number: 730620 Payment Type: Check Page: 3 of 3
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3492 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

Gen3- Retail								
RE531703	*FUEL FILTR*PRIMARY	1.00	74.52	74.52	\$74.52	N		
Labor: \$108.79		Parts: \$121.64	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$230.43			

Miscellaneous Charges:
SERVICE ACCESSORIES

\$24.80

Labor: \$495.99
Parts: \$160.60
OL&M: \$0.00
Misc: \$24.80
Sales Tax: \$0.00
Grand Total: \$681.39

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

Unused parts in new condition are returnable within 30 days of purchase and must be accompanied by this invoice. Returned parts are subject to a minimum 25% restocking fee. Open kits or electrical parts are not returnable. Please refer to our return policy for full details. Thank you for your business.

8120


**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
 36648 U.S. Highway 71
 Redwood Falls, MN 56283
 Phone: 507-644-3571
www.kibbleeq.com


JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: 5079384494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 2652920 Invoice Date: 11/30/2020 Location: 82 Work Order Number: 470042 Payment Type: Check Page: 1 of 6
--	---

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3056 Serial Number: RW8120P024561 Eq ID: 23735Z Fleet No:
---	---

KEI-INSPECTRC Retail
COMPLAINT:

01 KEI- ROW CROP TRACTOR INSPECTION

CORRECTION:

 Inspect machine using checklist relative to machine.
 Perform oil scans.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
DS0251	COOLANT SCAN TEST KIT	1.00	41.96	41.96	\$41.96	N
IPSKIT1	Oil Scan Test Kit	2.00	13.64	13.64	\$27.28	N
TY26349	1/4" suction tubing / Per Inch, 100"	27.00	0.04	0.04	\$1.08	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
SCANDISC	OIL SCAN DISCOUNT	-1.00	70.32	70.32	(\$70.32)	N

Labor: \$299.00	Parts: \$70.32	OL&M: \$0.00	Misc: (\$70.32)	Sub-Total: \$299.00
------------------------	-----------------------	-------------------------	------------------------	----------------------------

//8120 T2WD199 Retail
COMPLAINT:

04 Flush engine coolant system.

Drain coolant from radiator and block. Refill with fresh coolant and run machine in. Top off coolant. Run in, purge air in system, and test for leaks. Tested OK.

CORRECTION:

Flush engine coolant system. Replace coolant.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
--------------------	--------------------	-----------------	-------------------	------------------	-----------------------	------------------



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: 5079384494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number:	2652920
	Invoice Date:	11/30/2020
	Location:	82
	Work Order Number:	470042
	Payment Type:	Check
		Page: 2 of 6

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model:	JOHN DEERE 8120
	Meter:	3056
	Serial Number:	RW8120P024561
	Eq ID:	23735Z
	Fleet No:	

//8120 T2WD199 Retail								
TY27530S	110/4Qt Shop* COOLGARD II (4)	40.00	3.54	3.54	\$141.60	N		
Labor: \$225.00	Parts: \$141.60	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$366.60				

8120/1453/10 Retail

COMPLAINT:

05 STARTER - REMOVE & INSTALL

REMOVE & INSTALL STARTER

Disconnect all cables and wires .
Remove cap screws and nuts
Remove starter
Install the starter in reverse order.

CORRECTION:

Removed & Installed starter

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
SE501403	STARTER MO	1.00	534.21	534.21	\$534.21	N
SE501403-CR	CORE FOR: STARTER MO	-1.00	50.00	50.00	(\$50.00)	N
Labor: \$231.00	Parts: \$484.21	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$715.21		

//8120 T2WD36 Retail

COMPLAINT:

06 Batteries, Replace

CORRECTION:



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: 5079384494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 2652920 Invoice Date: 11/30/2020 Location: 82 Work Order Number: 470042 Payment Type: Check Page: 3 of 6
--	---

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3056 Serial Number: RW8120P024561 Eq ID: 23735Z Fleet No:
---	---

//8120 T2WD36 Retail
Batteries, Replace

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY25879A	Battery, Wet, 12V, BCI 31, CCA 925	2.00	197.51	197.51	\$395.02	N
TY25879A-CR	CORE for: Wet Charged Battery	-2.00	27.00	27.00	(\$54.00)	N
Labor: \$225.00		Parts: \$341.02	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$566.02	

//8120 T2WD152 Retail
COMPLAINT:
07 Transmission oil & filters, Replace (Clean pickup screen)

CORRECTION:
Transmission oil & filters, Replace (Clean pickup screen)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE174130	*HYD FILTE	1.00	87.85	87.85	\$87.85	N
TY26625S	Qt Shop HY-GARD (\$/qt) (4)	40.00	3.29	3.29	\$131.60	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EPA	EPA	1.00	3.00	3.00	\$3.00	N
Labor: \$225.00		Parts: \$219.45	OL&M: \$0.00	Misc: \$3.00	Sub-Total: \$447.45	

//8120 TMFD59 Retail
COMPLAINT:
08 MFWD gear lube, Replace (Differential & both planetary units)
Note: Hygard oil in differential, 85W140 gear lube in planetarys



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214	Invoice Number: 2652920 Invoice Date: 11/30/2020 Location: 82 Work Order Number: 470042 Payment Type: Check Page: 4 of 6
Bus Phone: 5079384494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214	Make/Model: JOHN DEERE 8120 Meter: 3056 Serial Number: RW8120P024561 Eq ID: 23735Z Fleet No:
Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	

//8120 TMFD59 Retail

CORRECTION:

MFWD gear lube, Replace (Differential & both planetary units)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY26817S	Qt Shop 80W90 GL5 lube (120)	8.00	6.47	6.47	\$51.76	N
Labor: \$150.00		Parts: \$51.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$201.76	

//8120 TMFD179 Retail

COMPLAINT:

09 MFWD axle seal, Replace (qty 1) LEFT FRONT

CORRECTION:

MFWD axle seal, Replace (qty 1)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
34M7077	12X50MM	2.00	2.05	2.05	\$4.10	N
34M7128	20X50MM	2.00	3.07	3.07	\$6.14	N
R95119	SEAL	2.00	14.53	14.53	\$29.06	N
RE588241	SEAL	1.00	89.18	89.18	\$89.18	N
TY26101	15 oz. Brake & Parts Cleaner	1.00	5.67	5.67	\$5.67	N
Labor: \$525.00		Parts: \$134.15	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$659.15	

Gen12- Retail

COMPLAINT:

12 Update 3000 receiver to latest software: 20-2 update JL 11/17/20



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: 5079384494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 2652920 Invoice Date: 11/30/2020 Location: 82 Work Order Number: 470042 Payment Type: Check Page: 5 of 6
--	---

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3056 Serial Number: RW8120P024561 Eq ID: 23735Z Fleet No:
---	---

Gen12- Retail
CORRECTION:

Labor: \$75.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$75.00
-----------------------	----------------------	-------------------------	---------------------	---------------------------

Gen1- Retail
COMPLAINT:

13 TROUBLESHOOT OIL LEAK ON SCV

CORRECTION:

DV-

- run tractor with jumper hose in scv and check for leaks
- found logic plate on #1 scv was leaking pretty bad
- removed valve stack from tractor
- customer decided to replace all 3 scv logic plates beings valve stack was off tractor
- replace all 3 scv logic plates
- reinstall valve stack on tractor with new o-rings
- wash rear of tractor off and dry
- run tractor with jumper hose in scv again to warm up oil
- check for leaks and all was good
- clean up area and put tools away

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
R73599	O-RING	2.00	1.75	1.75	\$3.50	N
RE220721	SCV PLATE	3.00	490.42	490.42	\$1,471.26	N
T122075	O-RING	2.00	1.81	1.81	\$3.62	N



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU
6374 150TH AVE
BELVIEW MN 56214

Bus Phone: 5079384494
Prv Phone: (507)938-4494 Mob Phone: (507)430-2940

Invoice Number: **2652920**
Invoice Date: 11/30/2020
Location: 82
Work Order Number: 470042
Payment Type: Check

Page: 6 of 6

Deliver To:

FRANKLIN KVENDRU
6374 150TH AVE
BELVIEW MN 56214

Bus Phone: (507)938-4494
Prv Phone: (507)938-4494 Mob Phone: (507)430-2940

Make/Model: JOHN DEERE 8120

Meter: 3056

Serial Number: RW8120P024561

Eq ID: 23735Z

Fleet No:

Gen1- Retail
TY26101

15 oz. Brake & Parts Cleaner

1.00

5.67

5.67

\$5.67

N

Labor: \$1,275.09

Parts: \$1,484.05

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$2,759.14

Miscellaneous Charges:

SERVICE ACCESSORIES

\$125.00

Labor: \$3,230.09

Parts: \$2,926.56

OL&M: \$0.00

Misc: \$57.68

Sales Tax: \$0.00

Grand Total: \$6,214.33

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

Unused parts in new condition are returnable within 30 days of purchase and must be accompanied by this invoice. Returned parts are subject to a minimum 25% restocking fee. Open kits or electrical parts are not returnable. Please refer to our return policy for full details. Thank you for your business.

8120


**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
 36648 U.S. Highway 71
 Redwood Falls, MN 56283
 Phone: 507-644-3571
www.kibbleeq.com


JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 1 of 10
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

EXPERT-1000000175560 Retail
COMPLAINT:

01 Kibble 8000 Series Tractor Expert Inspection *** VALUE OF THIS INSPECTION \$1140.00 ***
 CHANGE HYDRAULIC OIL AND FILTERS
 REPLACE FUEL FILTERS
 IMP SETTLES

CORRECTION:



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE


FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 2 of 10
---	---

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

EXPERT-1000000175560 Retail

Hours and Warranty Expiration, Check
 Safety Decals and Signs, Check
 Walk Around Final Check
 Cab Body, Check
 Shields, Guards, Handrails and Steps, Check
 Cab Doors, Check
 Cab Glass, Check
 Cab Mirrors, Check
 Operator Presence Sensor, Check
 Starter Operation, Check
 Stored Diagnostic Trouble Codes, Check
 Seat Operation and Seat Belt, Check
 Wiper and Washer Operation, Check
 Wiper Blade Condition, Check
 Air Conditioning System Charge, Check
 Air Conditioning System Operation, Check
 Air Conditioning Blower Motor Operation, Check
 Cab Heater Operation, Check
 Outside Cab Air Filter, Check
 Cab Recirculation Filter, Check
 Engine Oil and Filter, Check
 Cold Weather Starting Package, Check
 Engine Air Filters, Check
 Intake System, Hose and Clamps, Check
 Exhaust System, Check
 Turbocharger, Inspect
 Engine Valve Clearance, Check and Adjust
 Engine Oil Leaks, Check
 Engine Crankshaft Damper, Check
 Auxiliary Drive Belt and Tensioner, Check
 Engine Compartment, Check
 Engine Power, Check
 Coolant Level, Check
 Engine Coolant Condition and Freeze Point, Check
 Radiator Cap, Check

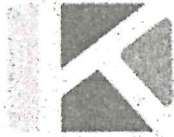

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571

www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number:	4648088
	Invoice Date:	2/3/2025
	Location:	82
	Work Order Number:	854286
	Payment Type:	Check
Page:		3 of 10

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

Radiator, Coolers, and Air Conditioning Condenser, Check
Cooling Hoses and Clamps, Check
HVAC, Fuel, and Hydraulic Oil Cooler Lines, Check
Fan, Fan Shroud, and Guards, Check
Water Pump, Inspect
Variable Fan Drive, Check
Fuel Leak, Check
Fuel Filters, Check
Optional Fuel Water Separator, Check
Fuel Transfer Pump, Check
Fuel Tank Vent, Check
Battery Condition, Check
Battery Cables and Ends, Inspect
Battery Disconnect Kit, Check
Starter Terminal Guard, Check
Alternator Charge, Check
Beacon, Field, Transport, and Warning Lights, Check
Wiring Harnesses, Check
Miscellaneous Electrical Components, Check
Hydraulic Oil Level and Filter, Check
Hydraulic Oil Suction and Sump Screens, Check
Transmission Hydraulic Oil Leaks, Check
Mid-Frame Driveshafts, Check
Transmission System Lube Pressure, Check
Transmission System Pressure, Check
Transmission Operation, Check
PTO, Check
PTO Operation, Check
MFWD or ILS Wheel Hub Oil, Check
MFWD U-Joints and Shielding, Check
MFWD Axle Breather Filter, Clean
Front Differential Oil Level - MFWD, Check
ILS, Preliminary Check
ILS, Operational Check
Transmission Drive Shaft Damper, Check
Rear Differential Oil Leaks, Check
Outer Axle Seal and Bearing Condition, Check



Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check
Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Page: 4 of 10

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	

Steering Operation, Check
AutoTrac System, Check
Rear Brake Operational, Check
Brake and Steering, Cylinders and Hoses, Check for Leakage
Tie Rod and Draft Link Ends, Check
Selective Control Valve and Coupler Leaks, Check
Selective Control Valve Operation, Check
Main Hydraulic Pump Stall Pressure, Test
Main Hydraulic Pump Flow, Check
Hydraulics, Final Check
Rear Hitch Operation, Check
Rear Hitch Assemblies, Check
Hitch Lift Cylinder and Lines, Check
Drawbar Pin, Check
Front Hitch Operation, Check
Front Hitch Components, Check
Wheel and Weight Bolt Tightness, Check
Frame and Weights, Inspect
Tires Condition, Check
Sheet Metal, Check
Radar Speed Sensor, Check
Stored Codes, Check
Fire Extinguisher, Inspect

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DS0251	COOLANT SCAN TEST KIT	1.00	51.43	51.43	\$51.43	Y
IPSKIT1	Oil Scan Test Kit	2.00	16.71	16.71	\$33.42	Y
TY26349	1/4" suction tubing / Per Inch, 100"	24.00	0.04	0.04	\$0.96	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 5 of 10
---	---

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

EXPERT-1000000175560 Retail SCANDISC OIL SCAN DISCOUNT	-1.00 85.81 85.81 (\$85.81) N
Labor: \$439.00 Parts: \$85.81 OL&M: \$0.00	Misc: (\$85.81) Sub-Total: \$439.00

EXPERT-1000000175352 Retail
COMPLAINT:
02 1 General Repair.

ether line broke

CORRECTION:

1. Make repairs as needed.

plug ether port on intake manifold and remove line

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE71255	PIPE PLUG	1.00	3.64	3.64	\$3.64	N
Labor: \$142.50	Parts: \$3.64	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$146.14		

EXPERT-1000000157427 Retail
COMPLAINT:
03 Hydraulic Oil and Filter, Change.

CORRECTION:

1. Drain hydraulic oil from differential, transmission and ILS housings.
2. Remove and replace hydraulic filter.
3. Remove and clean transmission filter screen. Replace if necessary.
4. Fill hydraulic oil, start and check for leaks.



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU
6374 150TH AVE
BELVIEW MN 56214

Bus Phone: (507)938-4494

Prv Phone: (507)938-4494

Mob Phone: (507)430-2940

Invoice Number: **4648088**

Invoice Date: 2/3/2025

Location: 82

Work Order Number: 851236

Payment Type: Check

Page: 6 of 10

Deliver To:

FRANKLIN KVENDRU
6374 150TH AVE
BELVIEW MN 56214

Bus Phone: (507)938-4494

Prv Phone: (507)938-4494

Mob Phone: (507)430-2940

Make/Model: JOHN DEERE 8120

Meter: 3719

Serial Number: RW8120P024561

Eq ID: 23735z

Fleet No:

EXPERT-1000000157427 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE174130	*HYD FILTE	1.00	142.17	142.17	\$142.17	N
TY26625S	Qt Shop HY-GARD (\$/qt) (4)	148.00	5.74	5.74	\$849.52	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
EPA	EPA	1.00	5.00	5.00	\$5.00	N

Labor: \$332.50 Parts: \$991.69 OL&M: \$0.00 Misc: \$5.00 Sub-Total: \$1,329.19

EXPERT-1000000181793 Retail

COMPLAINT:

04 SCV Breakaway Coupler, Remove and Replace.

CORRECTION:

1. Remove dust cover.
2. Clean coupler and housing.
3. Remove snap ring and coupler.
4. Remove and replace sealing rings.
5. Install new coupler.
6. Assemble in reverse order.
7. Test coupler.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE577560	SCV ISO Breakaway Coupler	4.00	134.37	134.37	\$537.48	N

Labor: \$442.70 Parts: \$537.48 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$980.18

EXPERT-1000000243323 Retail

COMPLAINT:



Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



SERVICE INVOICE

Invoice To Account No: 8535644

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 7 of 10
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

EXPERT-1000000243323 Retail
05 Auxiliary Drive Belt, Remove and Replace.

CORRECTION:

1. Lift hood.
2. Release the belt tension.
3. Remove and replace the belt.
4. Assemble in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R228118	V-BELT	1.00	55.66	55.66	\$55.66	N

Labor: \$285.00 Parts: \$55.66 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$340.66

EXPERT-1000000199351 Retail
COMPLAINT:
06 Battery Terminals, Clean.

CORRECTION:

1. Loosen and remove cables.
2. Clean posts and cable ends.
3. Install cables and tighten.

Labor: \$190.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$190.00

EXPERT-1000000157138 Retail
COMPLAINT:
07 Primary and Secondary Fuel Filters, Remove and Replace.

CORRECTION:



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 8 of 10
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No: 40480
---	---

EXPERT-1000000157138 Retail

1. Disconnect water in fuel sensor and drain fuel filters.
2. Remove fuel filters and discard.
3. Swap sensor over to new filter.
4. Prefill filters using provided funnel.
5. Install filters, connect sensor, bleed system and start engine.
6. Check for leaks.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE522688	*2M.FUEL FILT*SECONDARY	1.00	46.17	46.17	\$46.17	N
RE531703	*FUEL FILTR*PRIMARY	1.00	74.52	74.52	\$74.52	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EPA	EPA	2.00	5.00	5.00	\$10.00	N
Labor: \$190.00 Parts: \$120.69 OL&M: \$0.00 Misc: \$10.00 Sub-Total: \$320.69						

EXPERT-1000000146374 Retail

COMPLAINT:

08 Cab Air and Recirculation Filters, Replace. OMDMU21014 - MY04

CORRECTION:

1. Remove filters.
2. Clean housings and covers.
3. Install new filters.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE187966	*AIR FILTE-CAB	1.00	37.41	37.41	\$37.41	N



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088 Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 9 of 10
---	--

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
---	---

EXPERT-1000000146374 Retail

RE24619	Cab Air Filter	1.00	49.44	49.44	\$49.44	N
---------	----------------	------	-------	-------	---------	---

Labor: \$47.50	Parts: \$86.85	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$134.35
-----------------------	-----------------------	-------------------------	---------------------	----------------------------

Gen1- Retail

COMPLAINT:

09 General Repairs
change front axle oils. Hubs and differential

CORRECTION:

0V-
- drain oil from front hubs and center differential
- refill hubs and diff with new oil

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
36648 U.S. Highway 71
Redwood Falls, MN 56283
Phone: 507-644-3571
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8535644

SERVICE INVOICE

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Invoice Number: 4648088
	Invoice Date: 2/3/2025 Location: 82 Work Order Number: 851236 Payment Type: Check Page: 10 of 10

Deliver To:

FRANKLIN KVENDRU 6374 150TH AVE BELVIEW MN 56214 Bus Phone: (507)938-4494 Prv Phone: (507)938-4494 Mob Phone: (507)430-2940	Make/Model: JOHN DEERE 8120 Meter: 3719 Serial Number: RW8120P024561 Eq ID: 23735z Fleet No:
--	--

Gen1- Retail							
TY26625S	Qt Shop HY-GARD (\$/qt) (4)	22.00	5.74	5.74	\$126.28	N	
Labor: \$222.30		Parts: \$126.28	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$348.58		

Miscellaneous Charges:		
SERVICE ACCESSORIES		\$114.58

Labor: \$2,291.50
Parts: \$2,008.10
OL&M: \$0.00
Misc: \$43.77
Sales Tax: \$6.27
Grand Total: \$4,349.64

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

Unused parts in new condition are returnable within 30 days of purchase and must be accompanied by this invoice. Returned parts are subject to a minimum 25% restocking fee. Open kits or electrical parts are not returnable. Please refer to our return policy for full details. Thank you for your business.